



NO.	ISSUE	DATE
Job Number	152181.000	
Drawn	REC	
Checked	BMH	
Approved	JHT	


12 SLOPED TOPPING SLAB & SLAB
 NOT TO SCALE

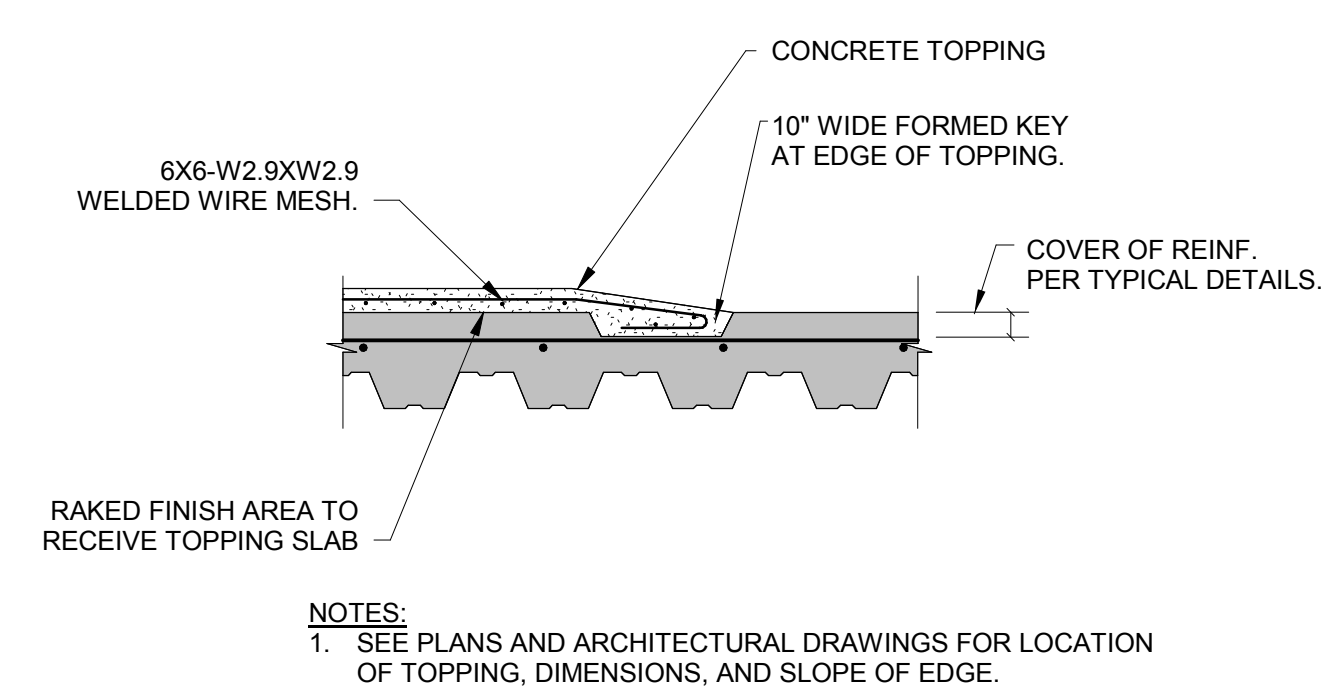


13 TYPICAL STAIR HEADER BEAM DETAIL
 NOT TO SCALE

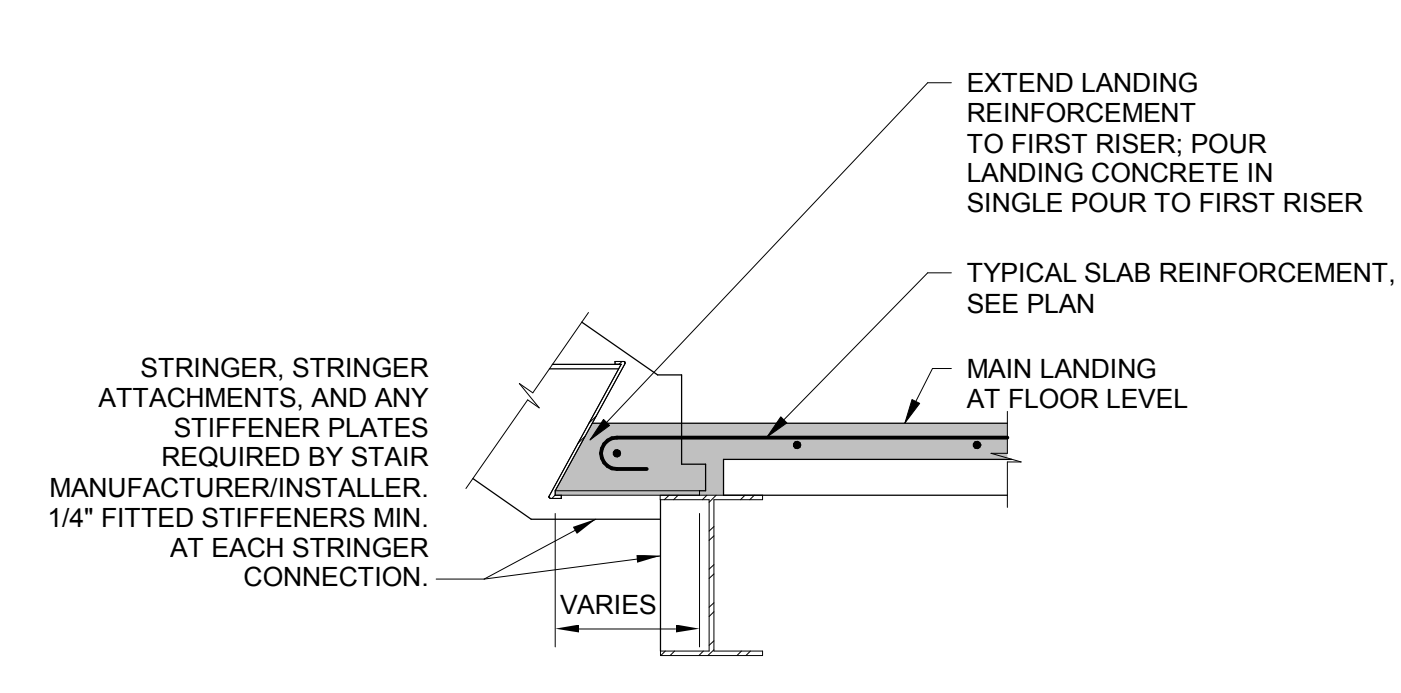


14 FRAMING AT CONDUIT BANK
 NOT TO SCALE

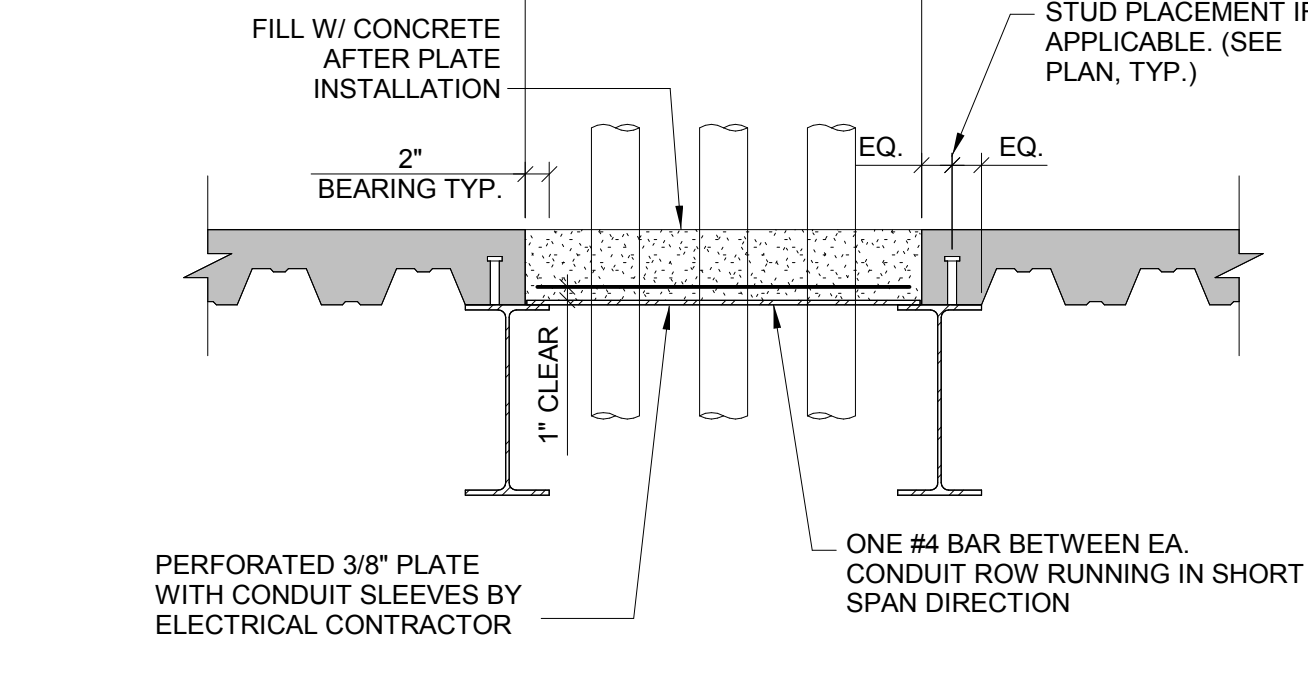


15 CONDUIT PLACEMENT IN COMPOSITE SLABS
 NOT TO SCALE

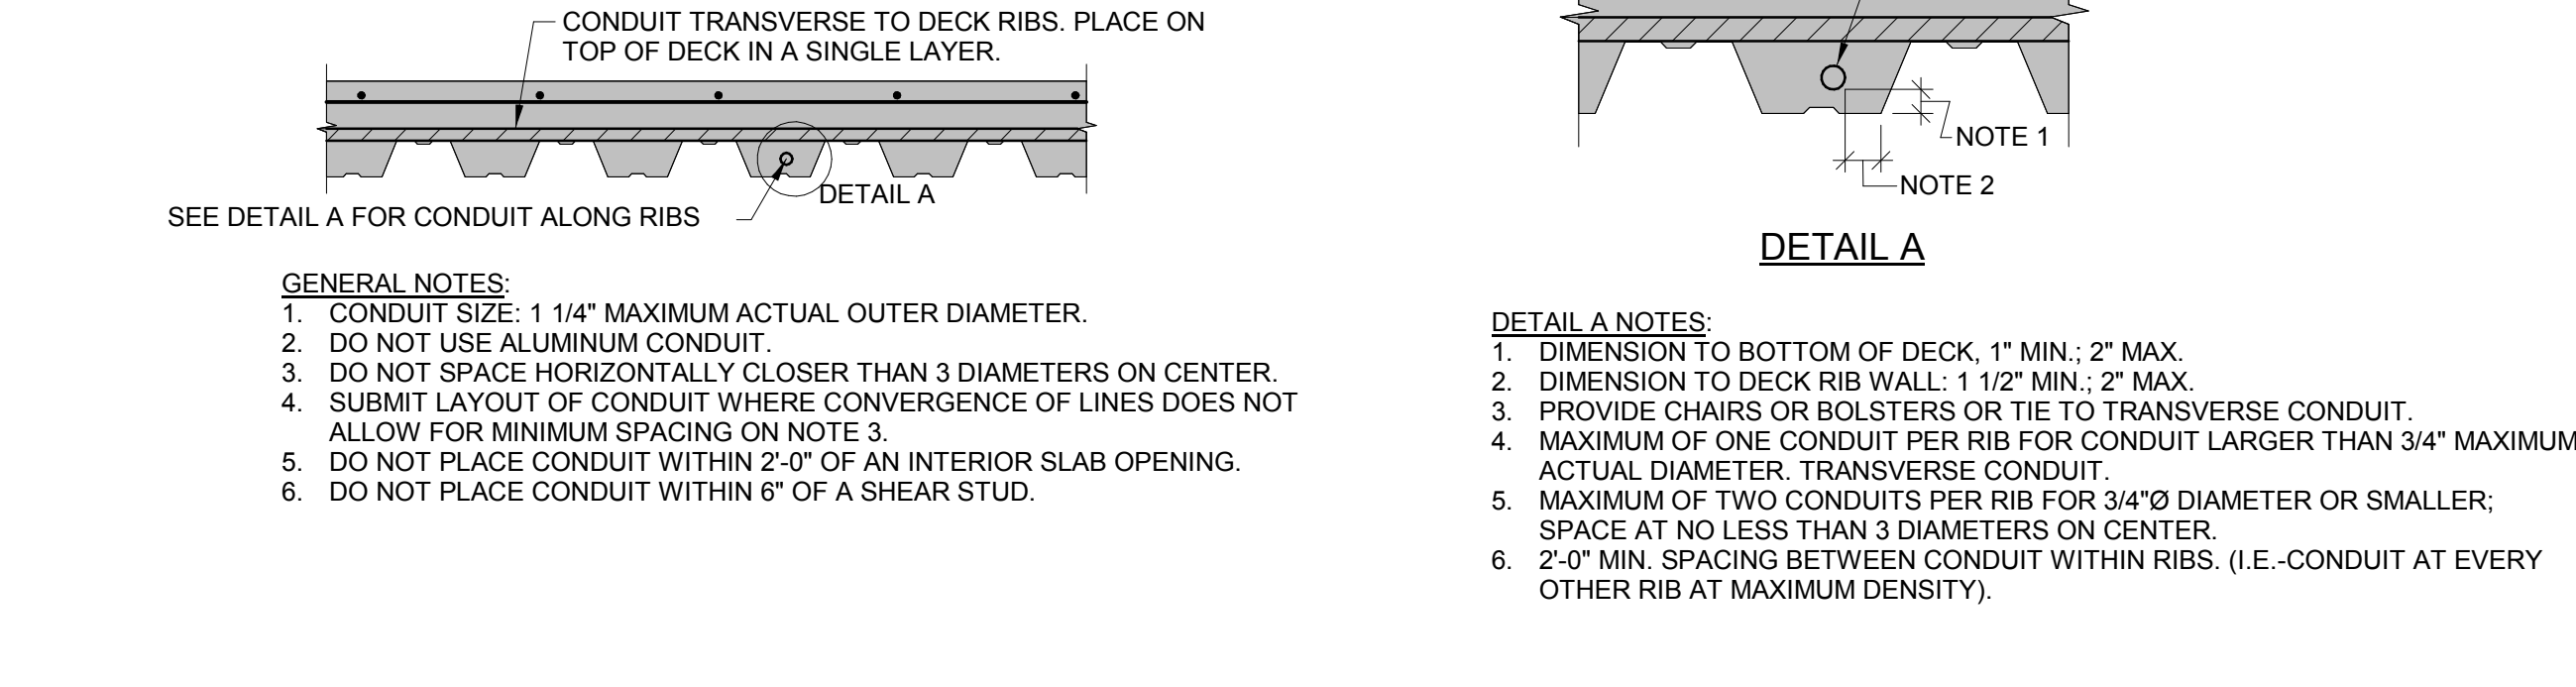


9 COMPOSITE SLAB REINFORCEMENT AND EDGE CONDITION DETAIL
 NOT TO SCALE

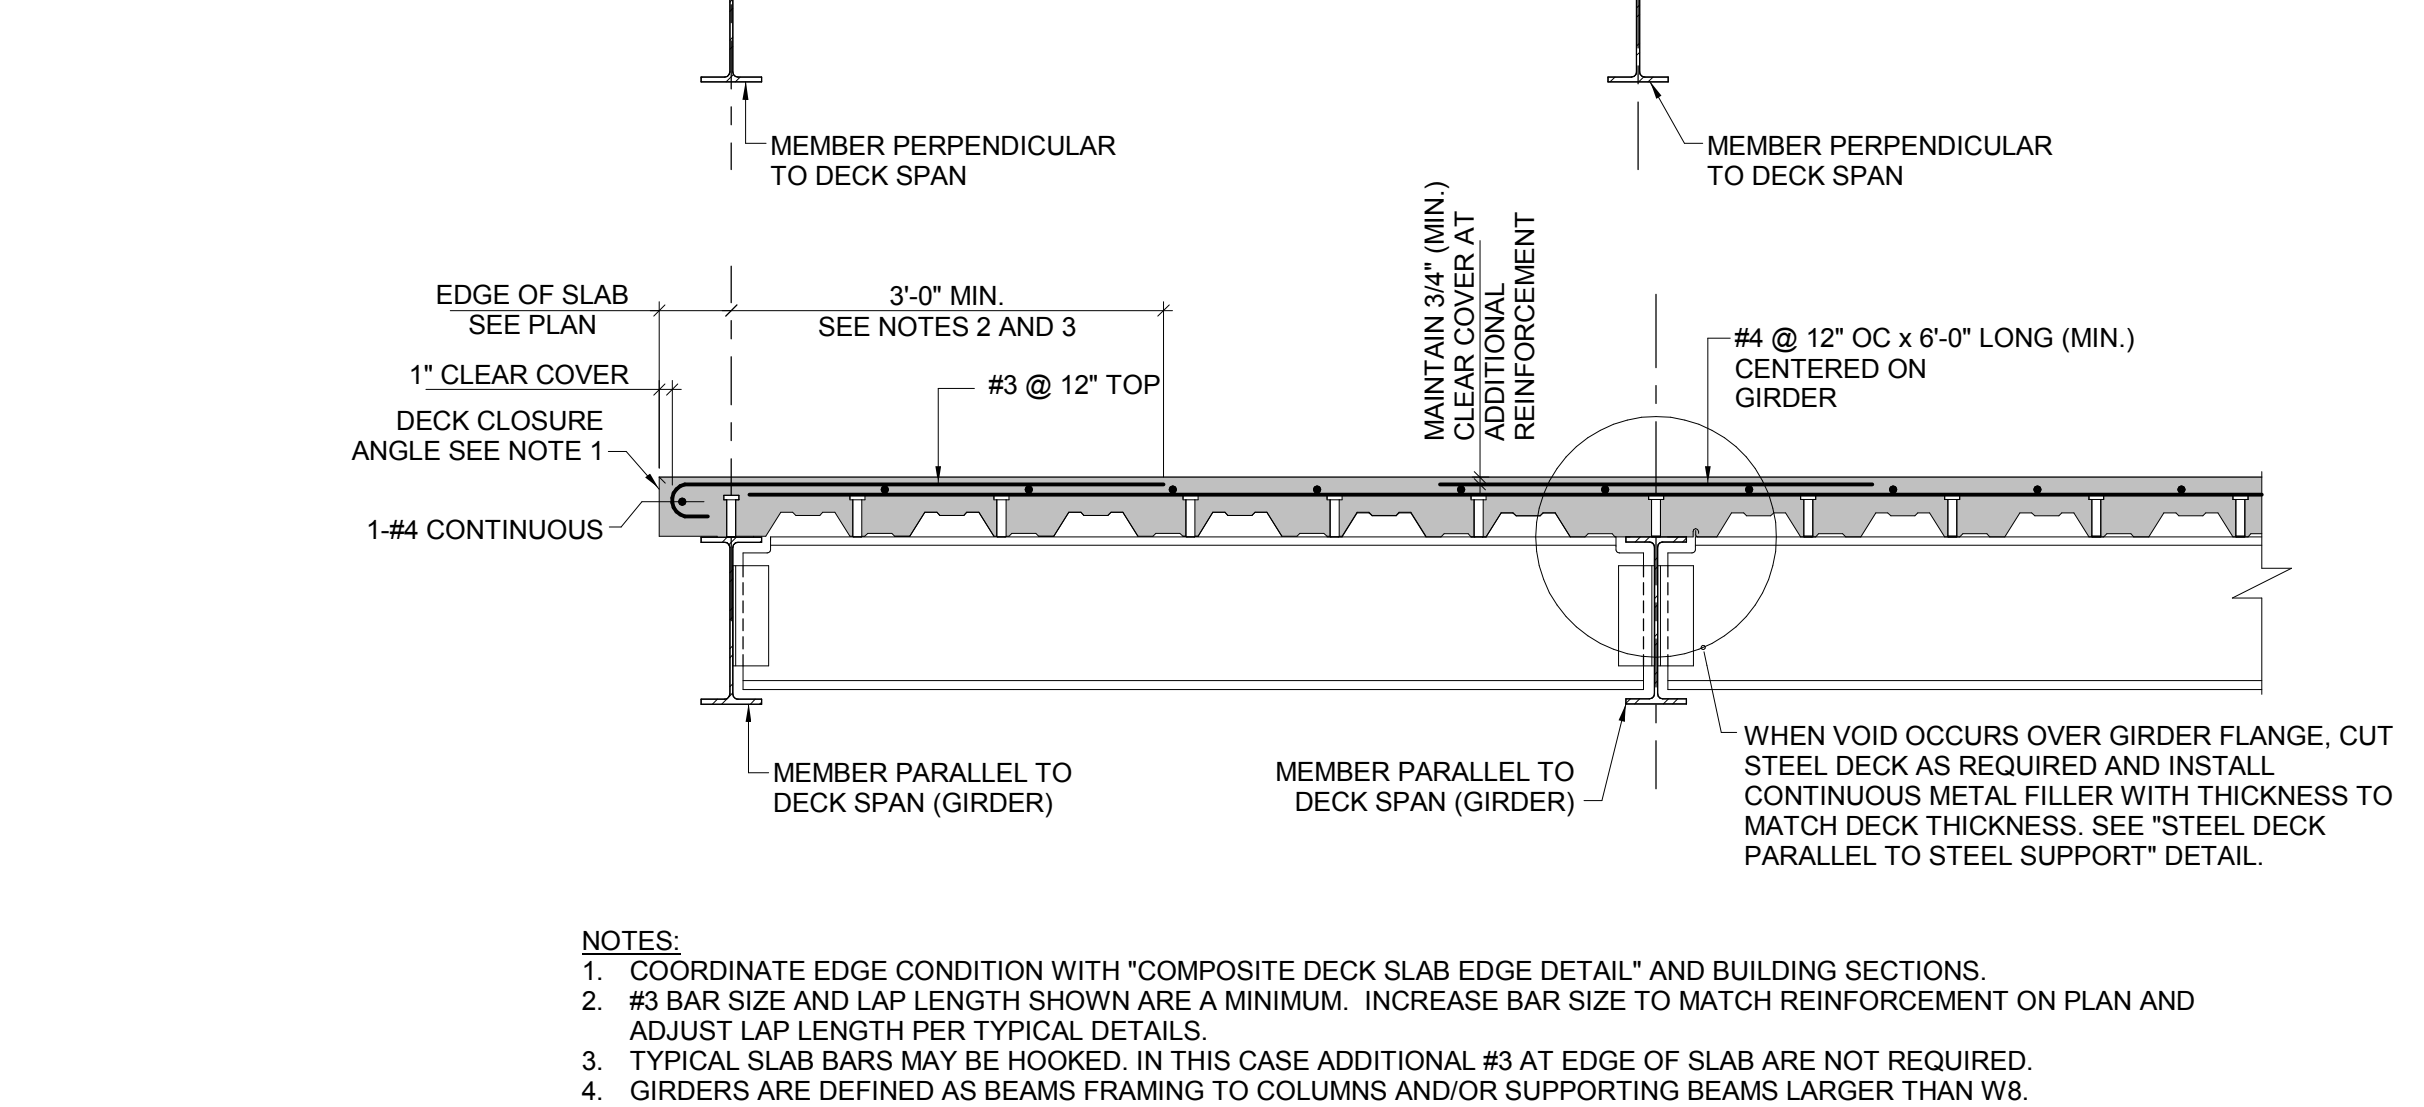


10 SLAB DROP: DECK AND REINFORCING DETAILS
 NOT TO SCALE

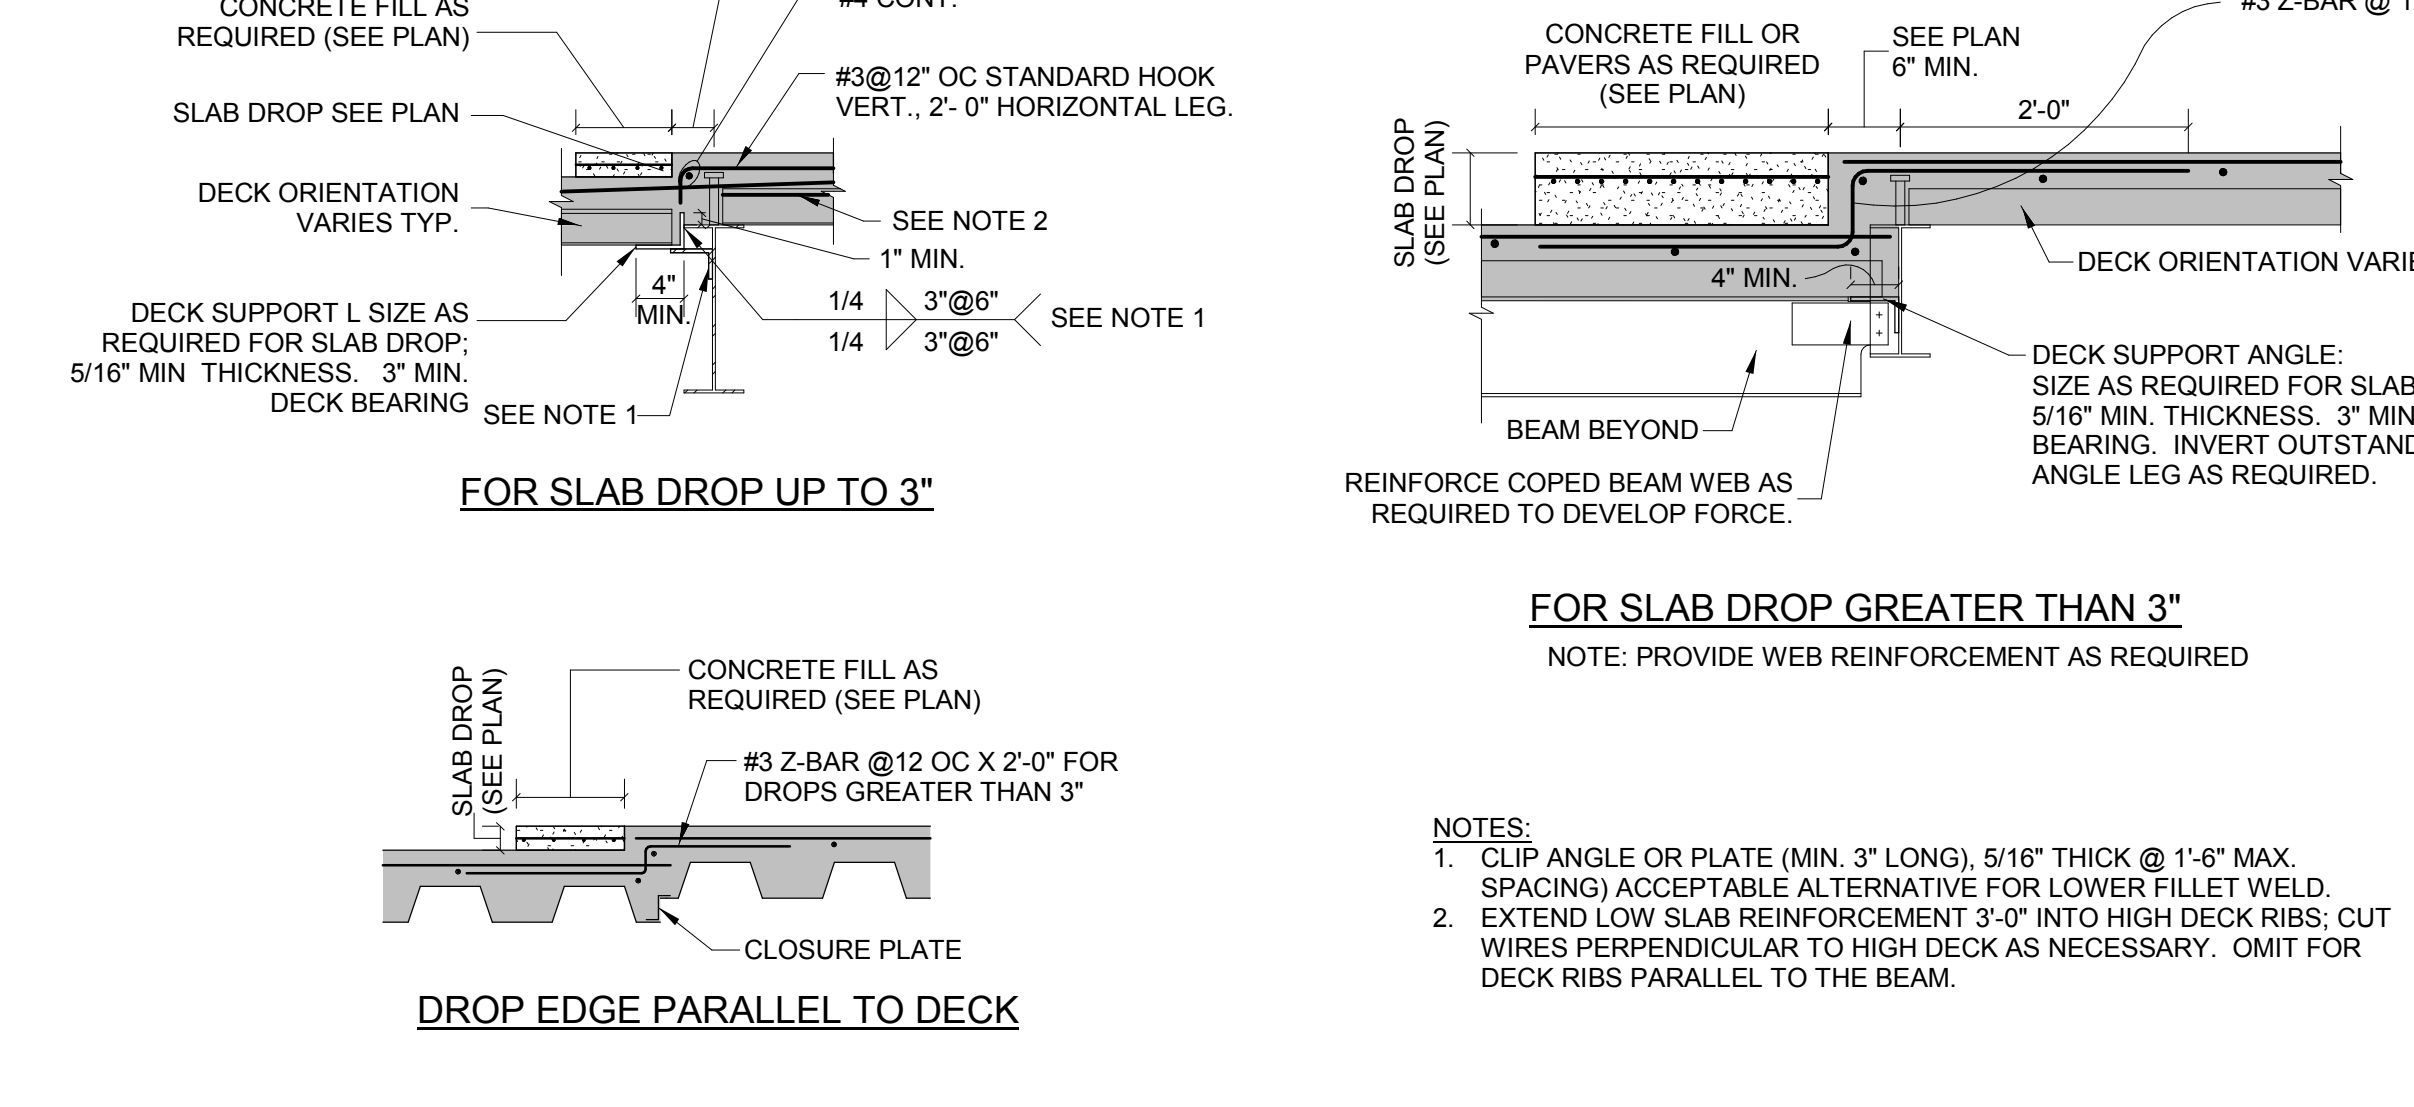


11 LADDER SUPPORT RAILS
 NOT TO SCALE

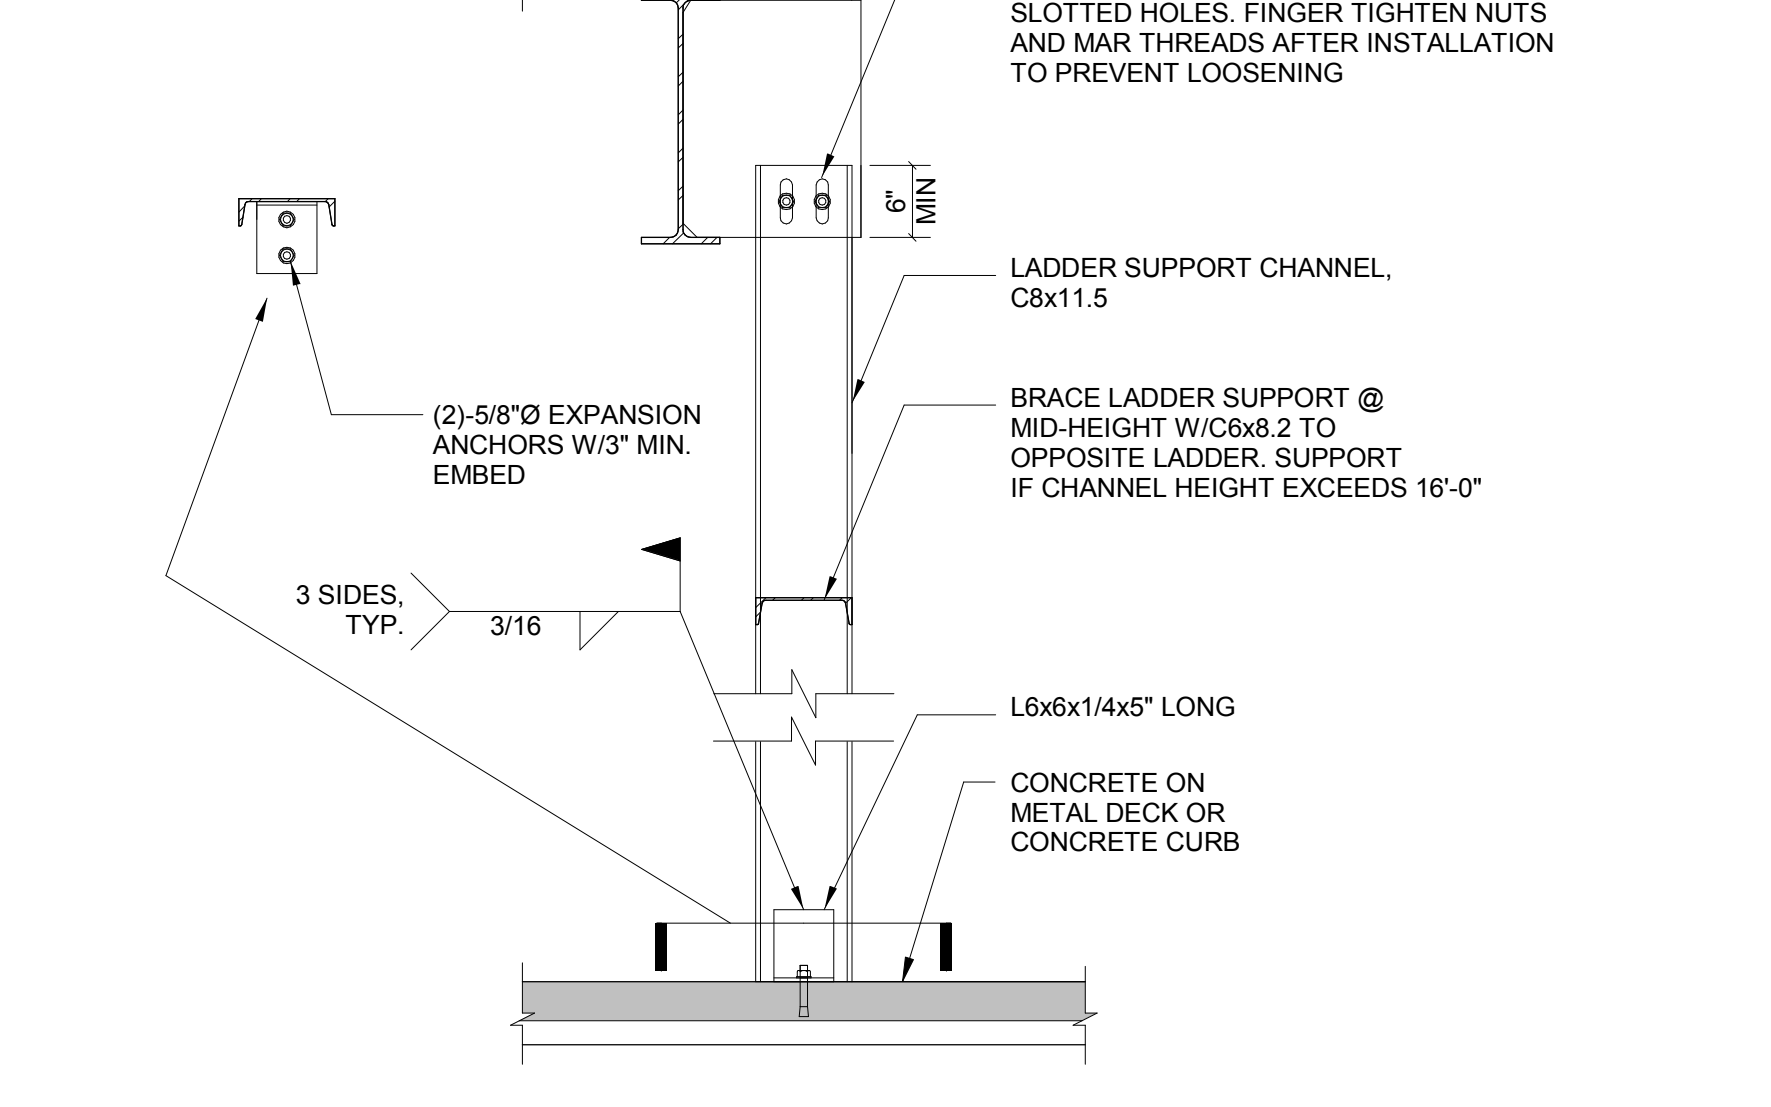


6 STEEL DECK DIRECTION CHANGE DETAIL
 NOT TO SCALE

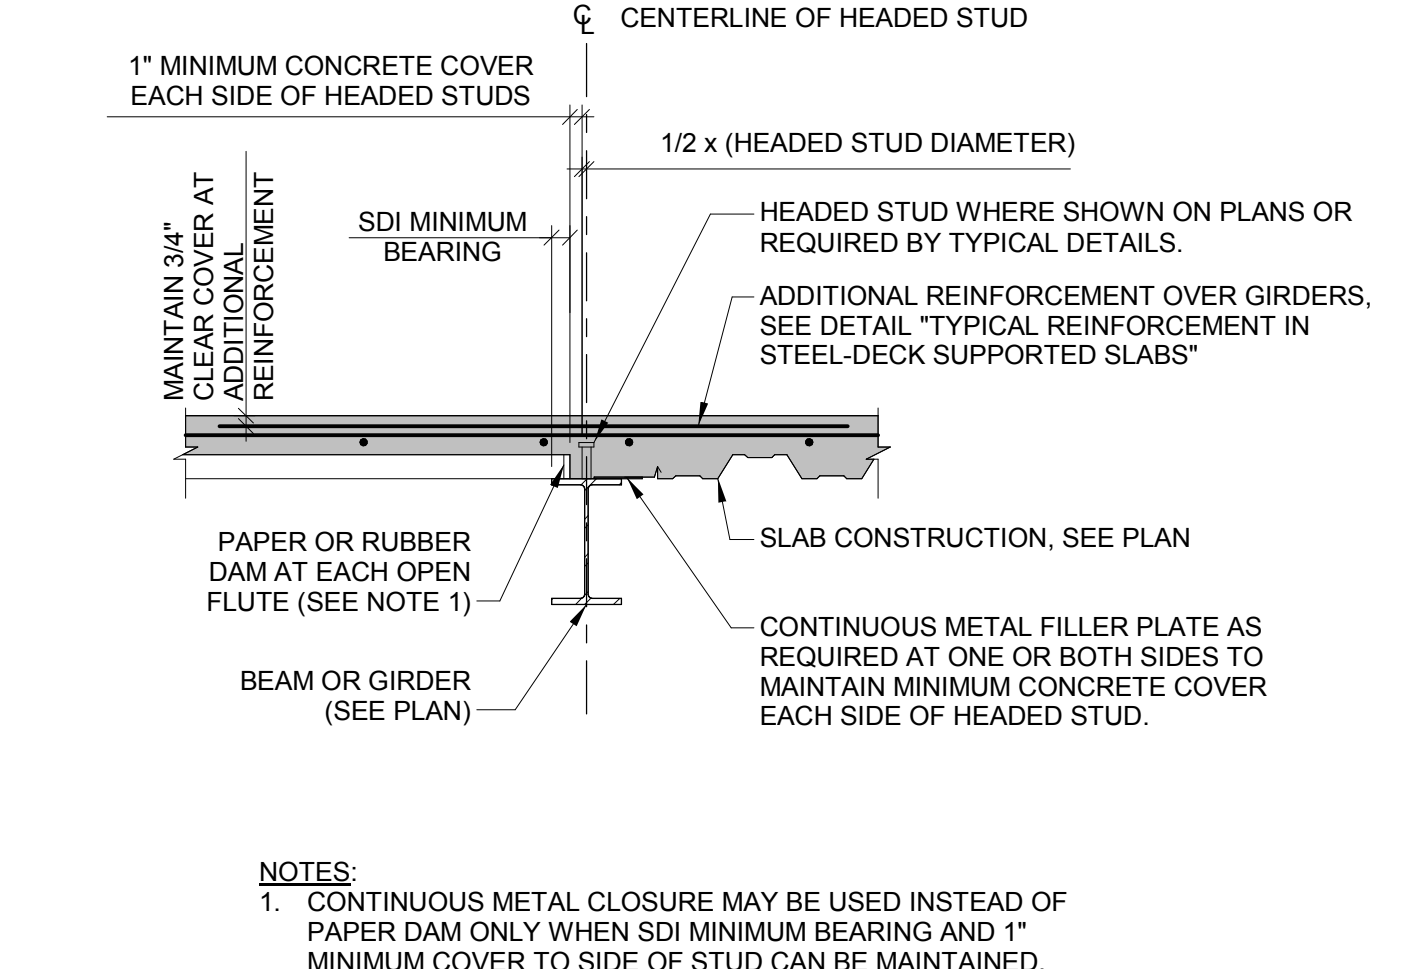


7 STEEL DECK PARALLEL TO STEEL SUPPORT DETAIL
 NOT TO SCALE

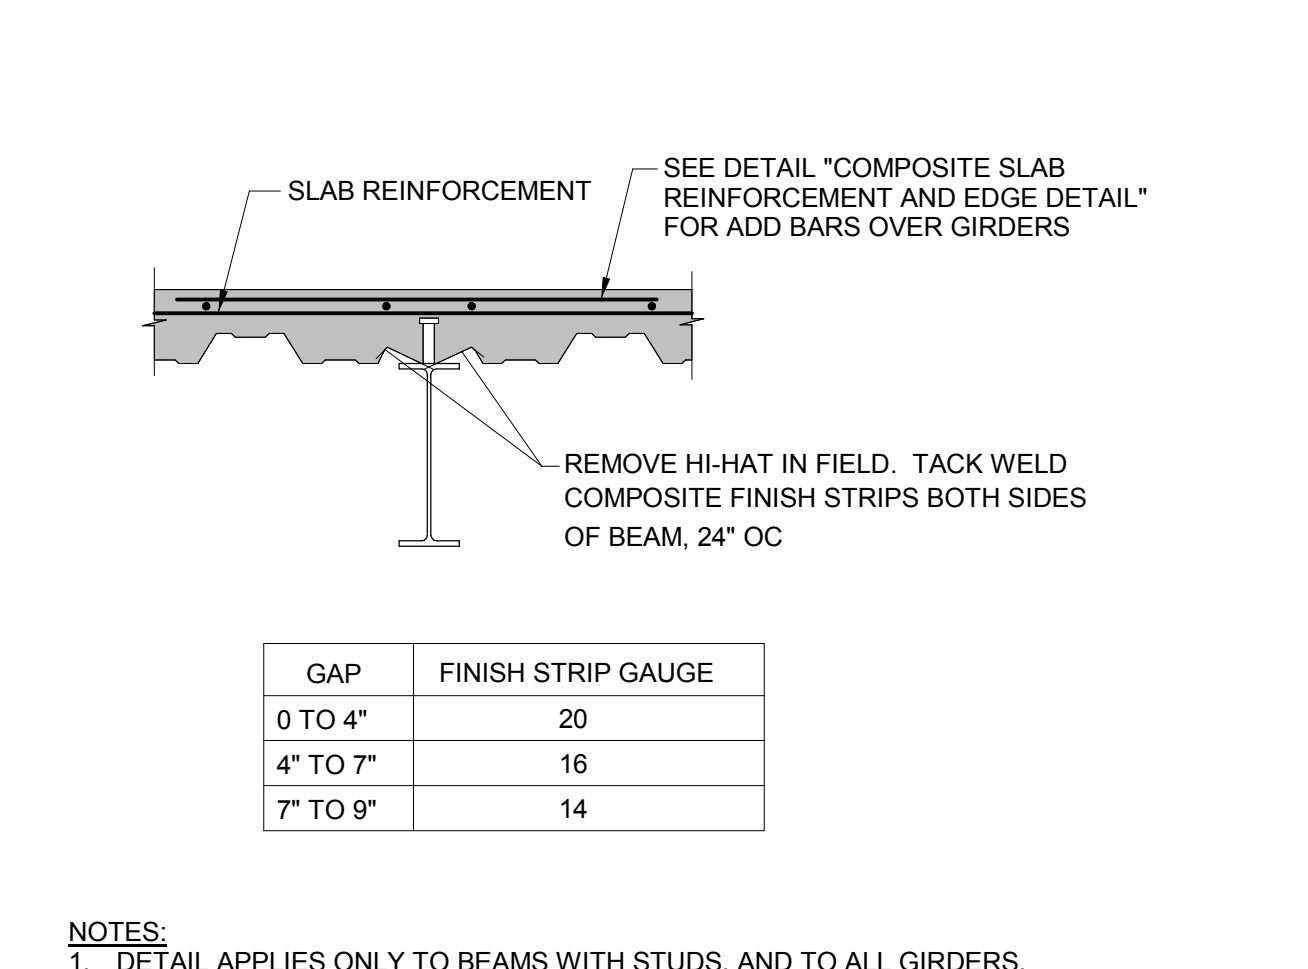


5 DECK REINFORCEMENT AT CONDUIT BANK FLOOR PENETRATIONS
 NOT TO SCALE

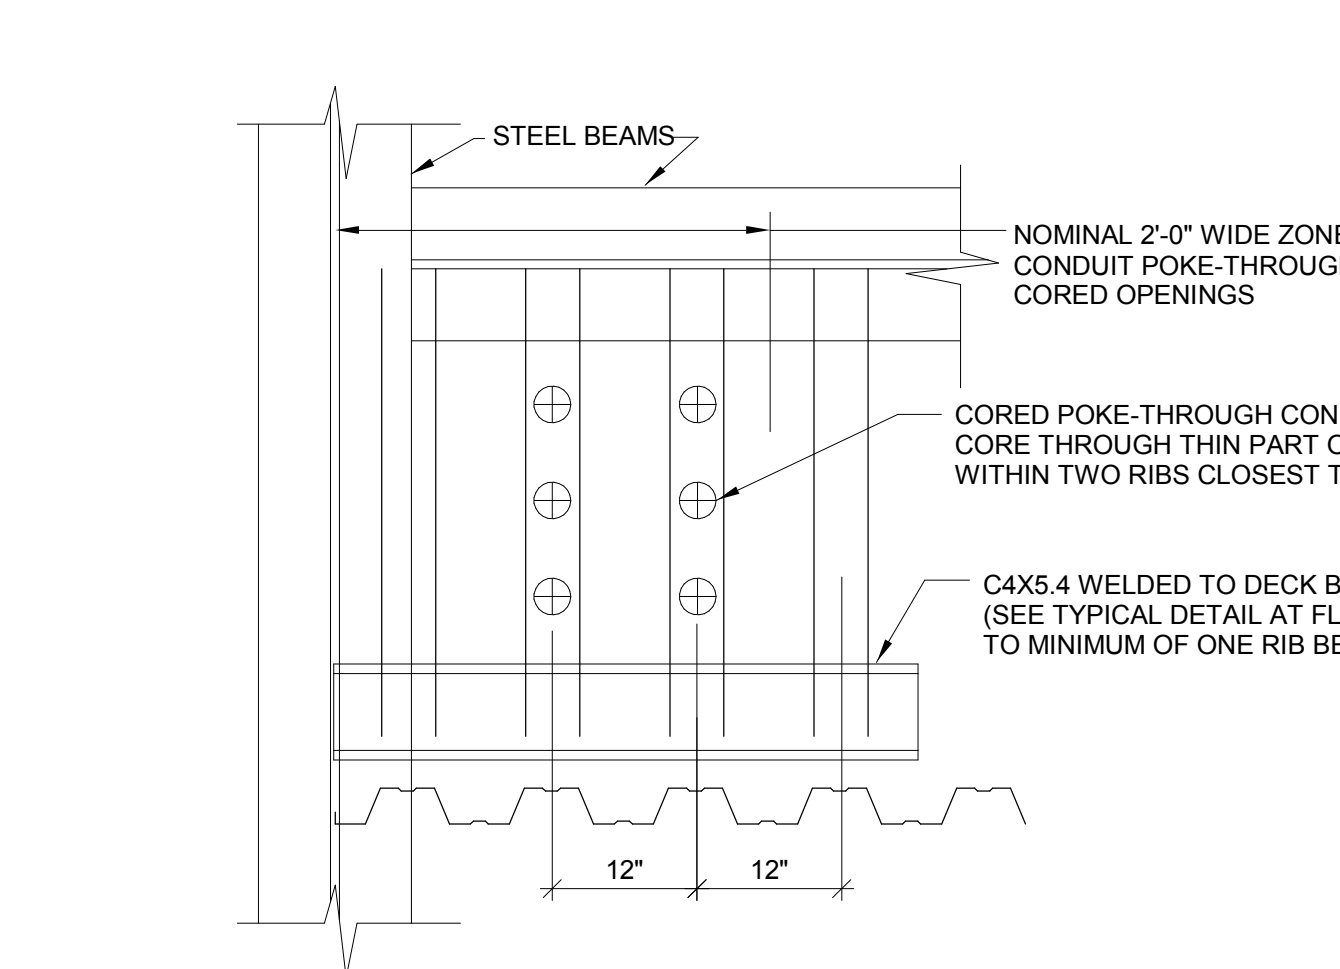


2 DECK SUPPORT AT PERIMETER COLUMNS
 NOT TO SCALE

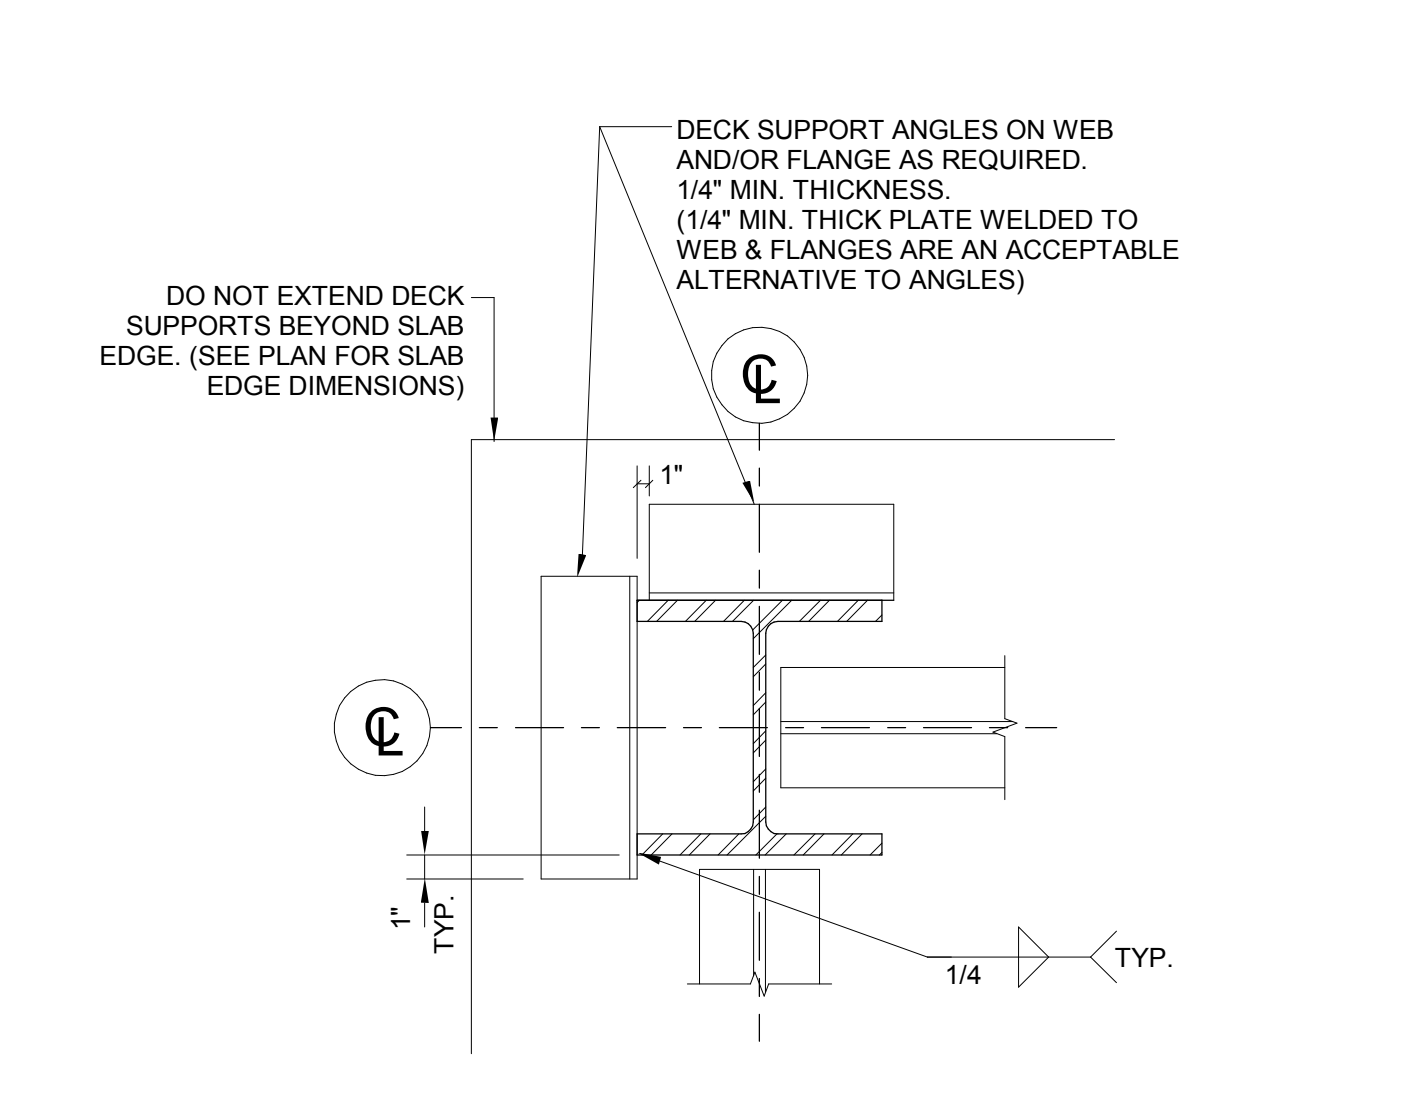


1 DECK SUPPORT AT MOMENT CONNECTION AT COLUMN
 NOT TO SCALE

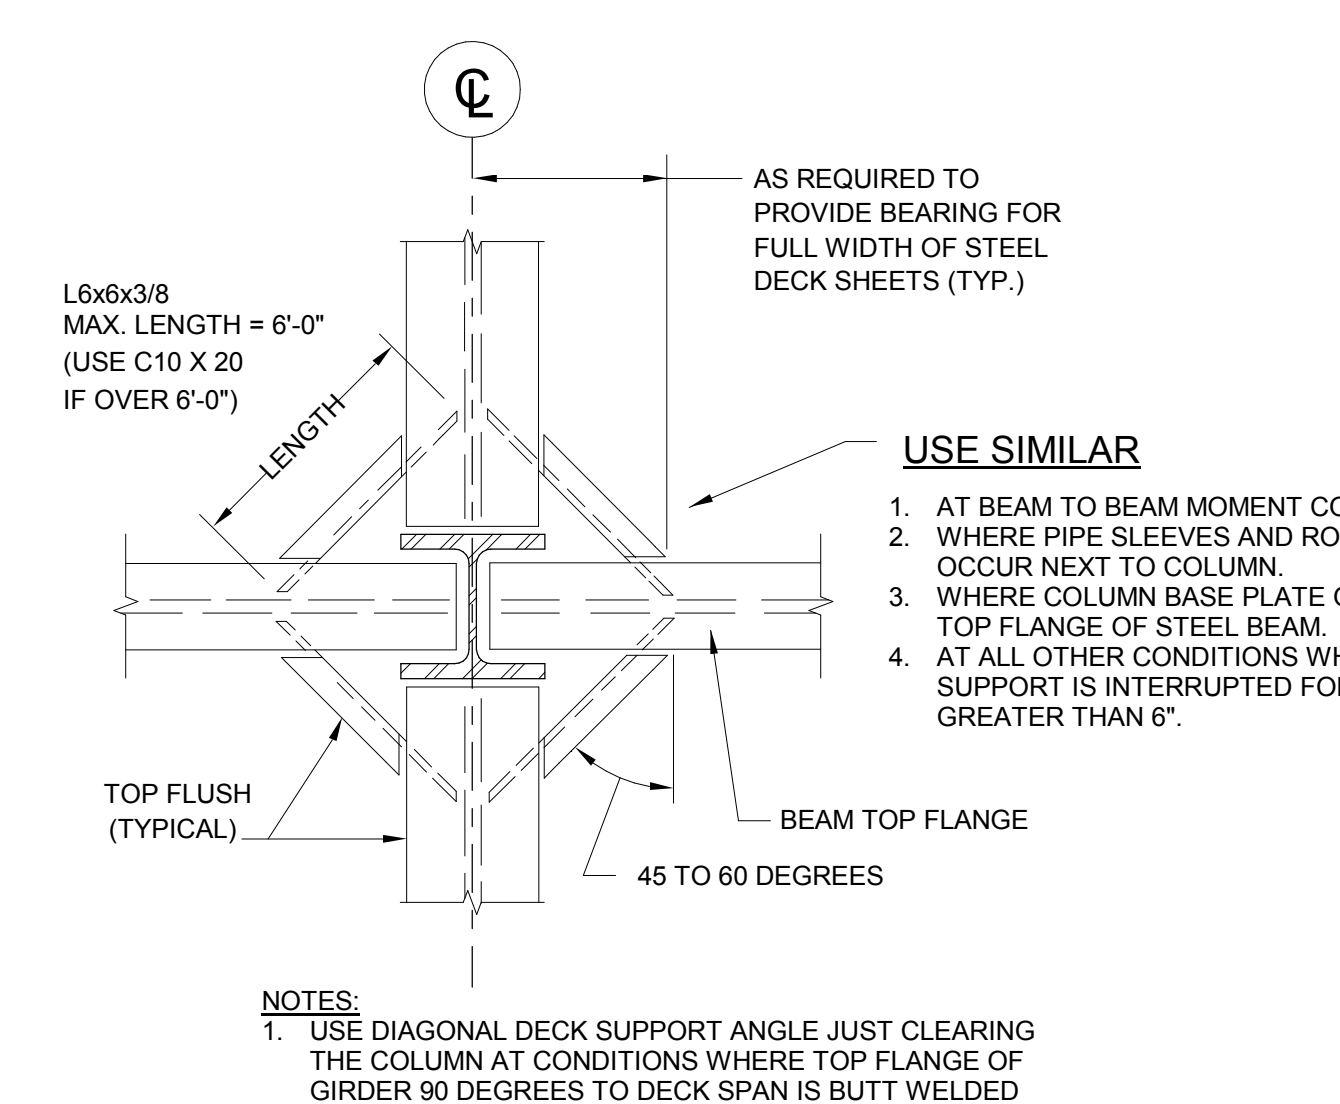


3 FASTENING PATTERN FOR COMPOSITE METAL FLOOR DECK
 NOT TO SCALE

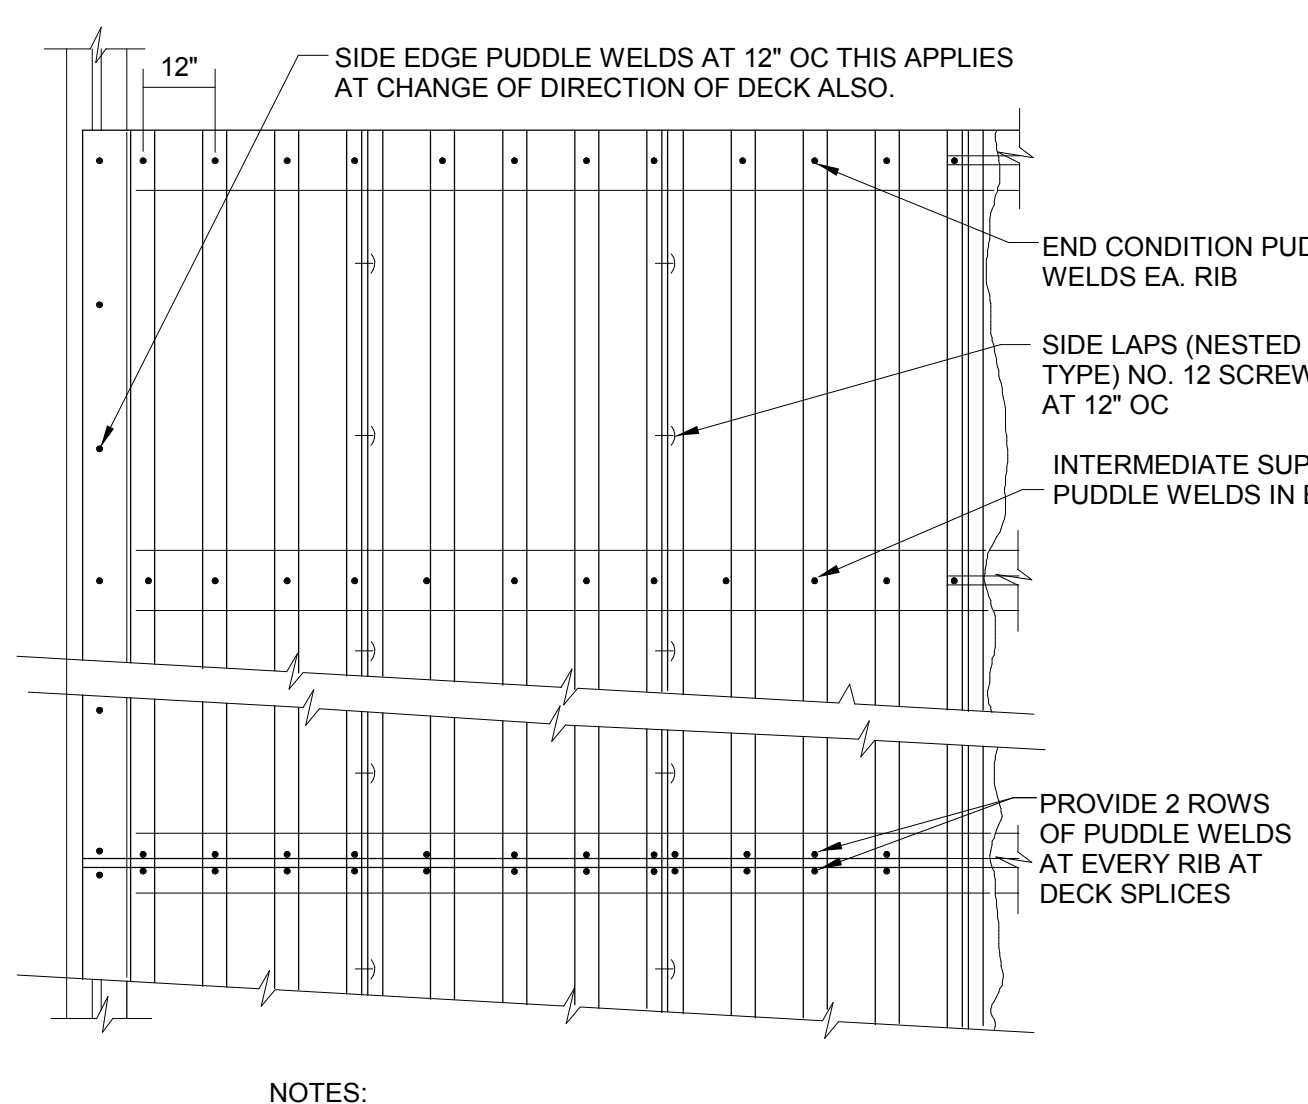


4 COMPOSITE FLOOR DECK REINFORCING AT OPENINGS
 NOT TO SCALE

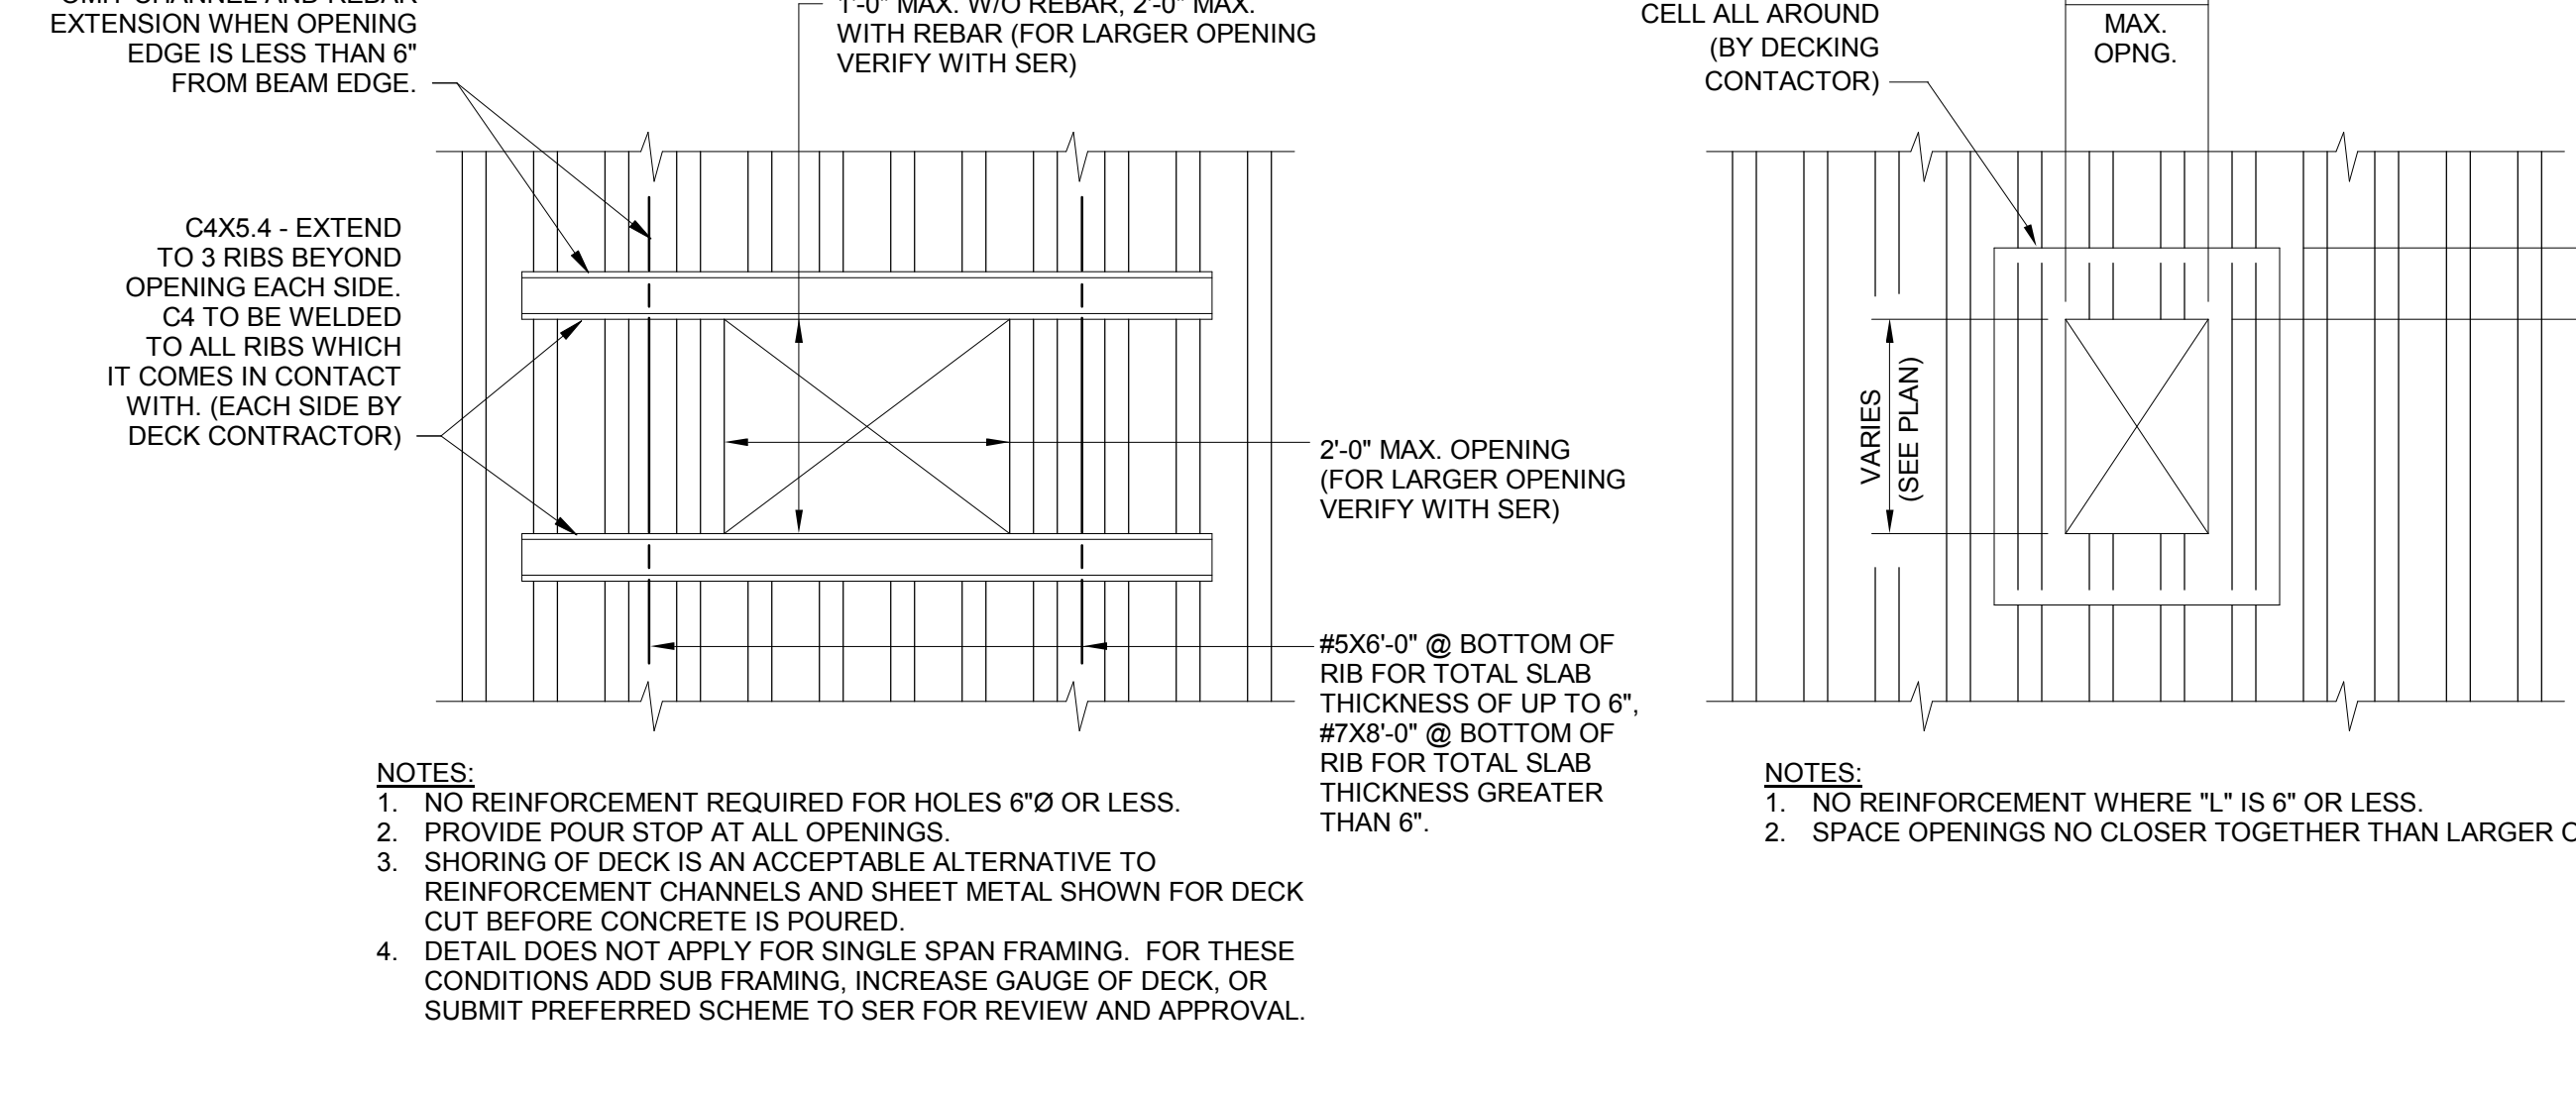


8 FLOOR OPENING ON BOTH SIDES OF BEAM
 NOT TO SCALE

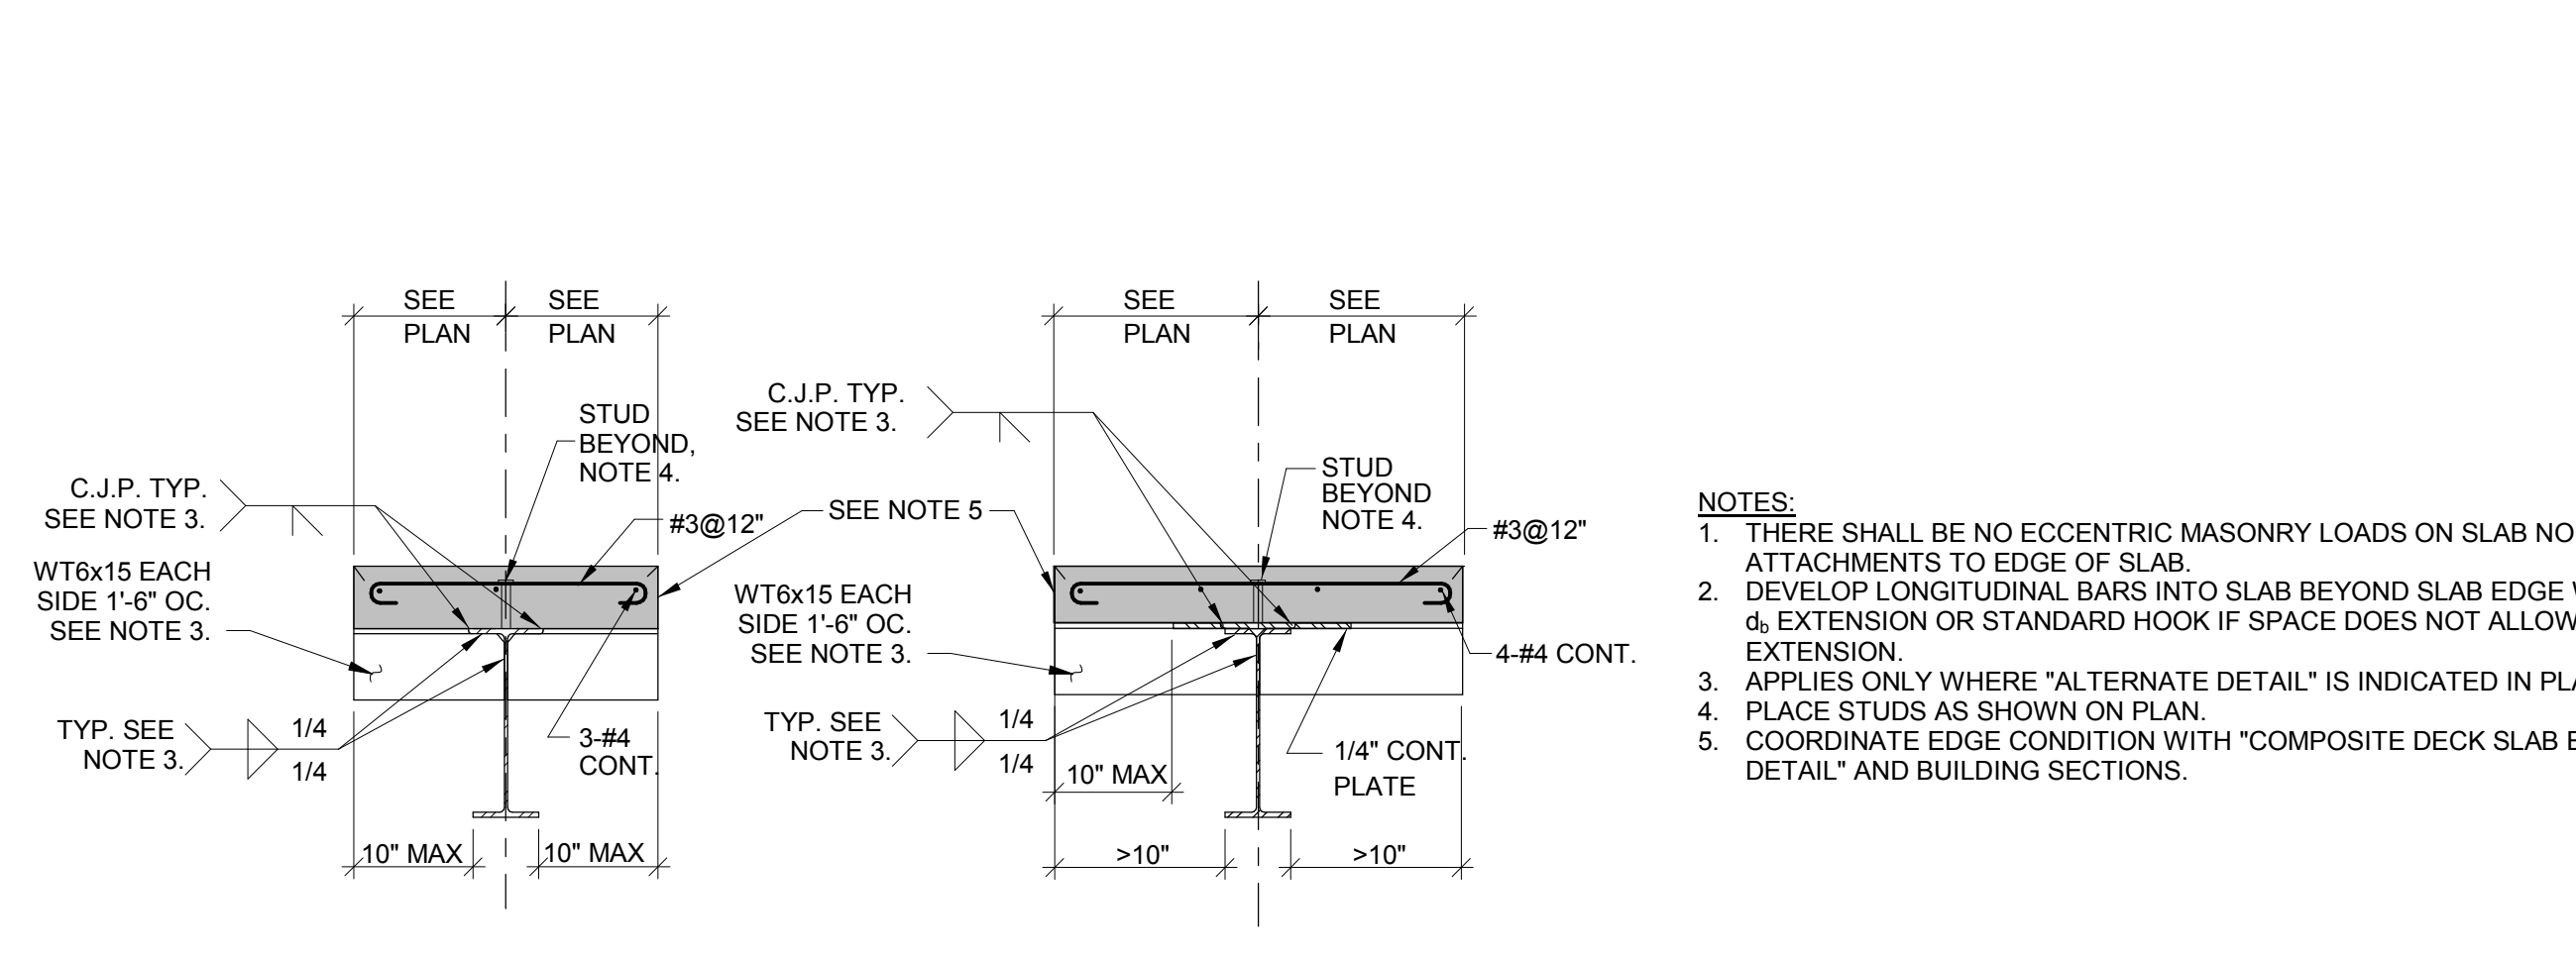


11 LADDER SUPPORT RAILS
 NOT TO SCALE

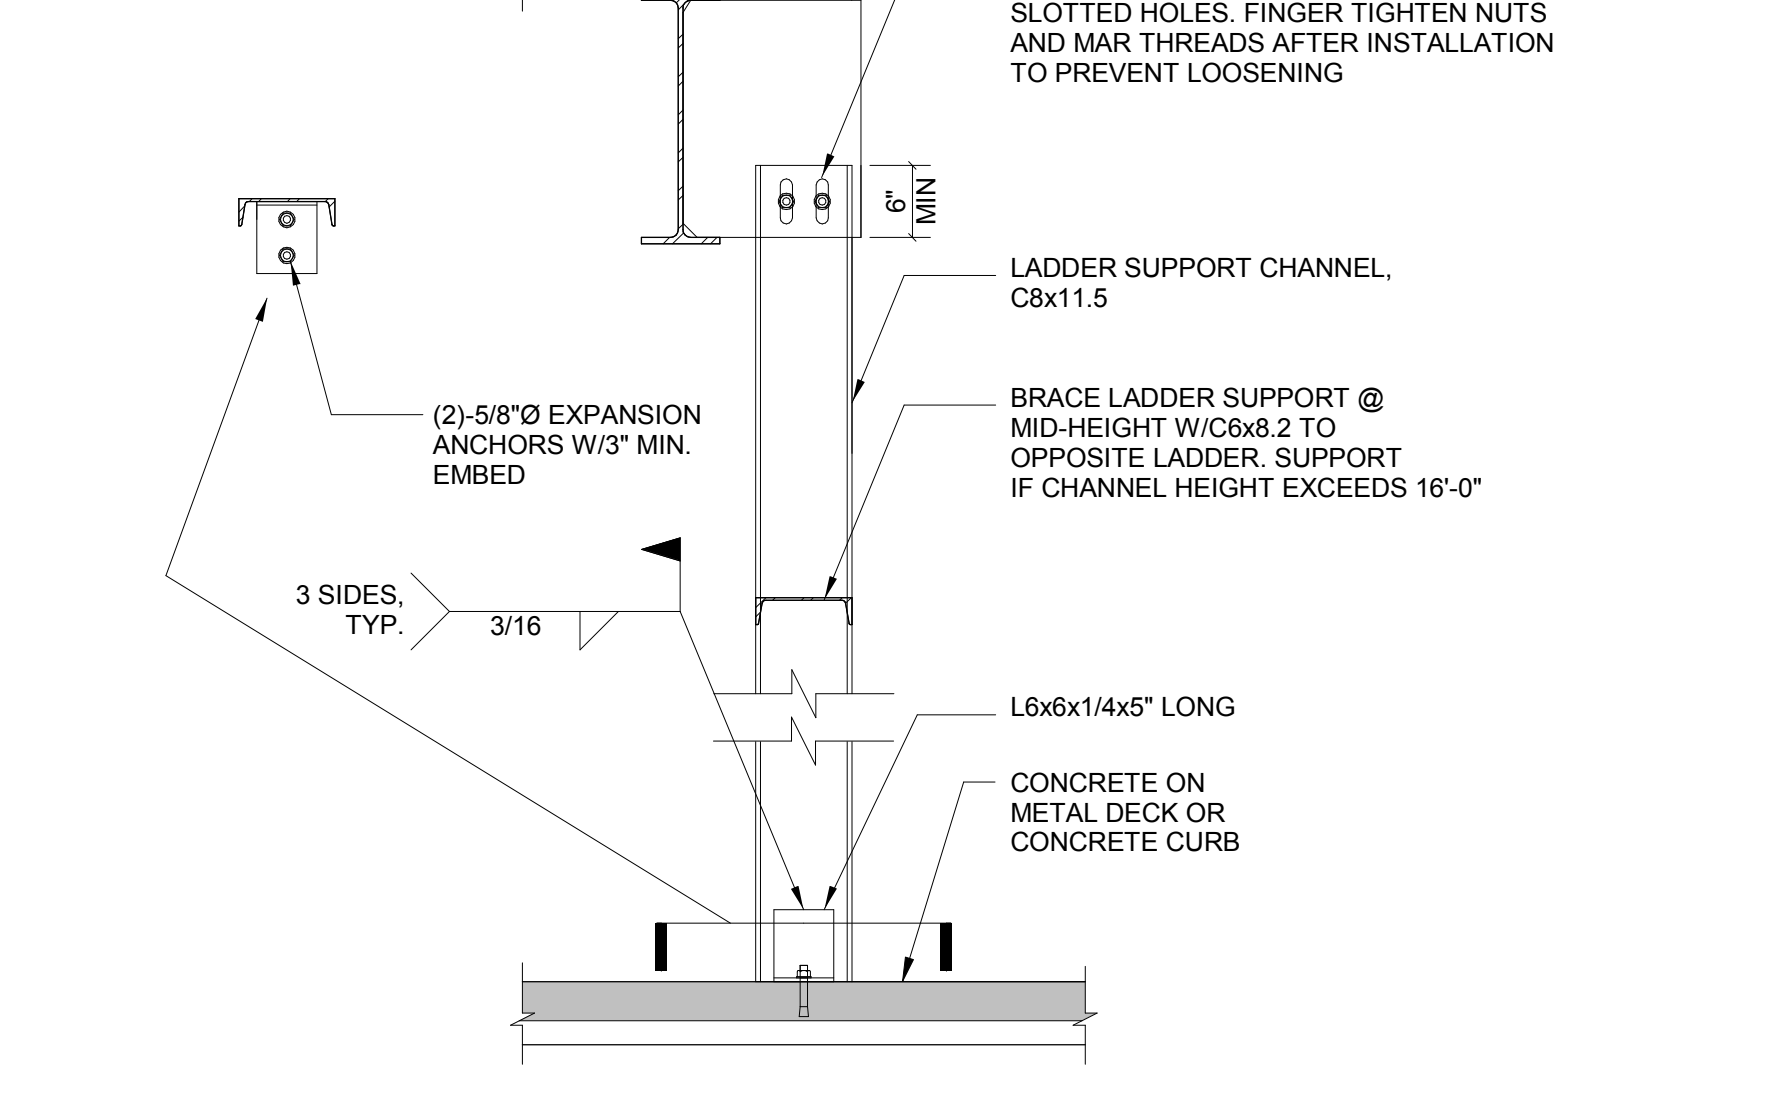


10 SLAB DROP: DECK AND REINFORCING DETAILS
 NOT TO SCALE

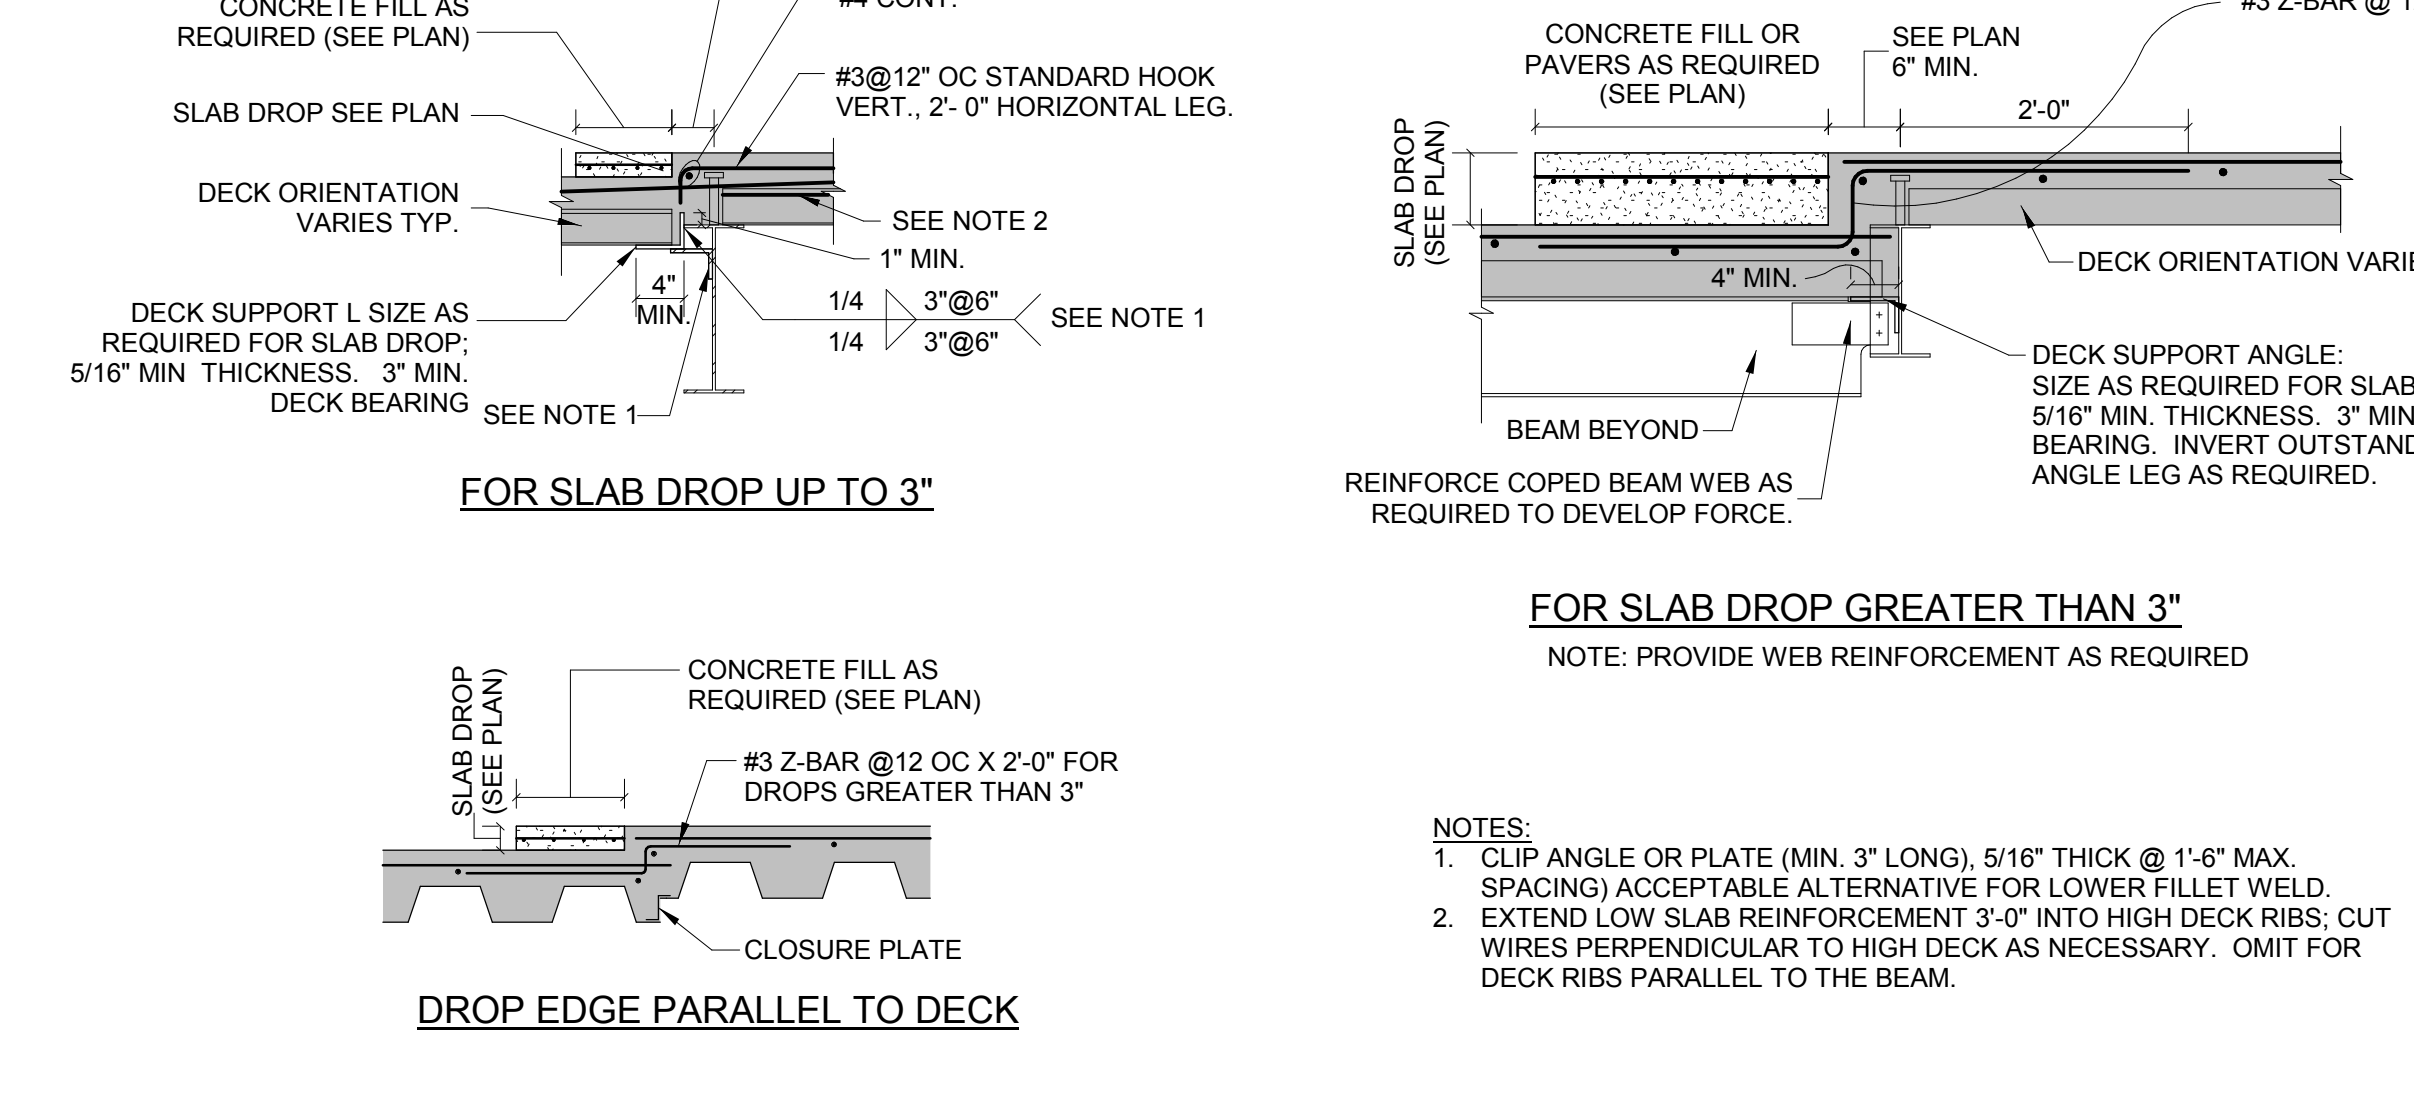

14 FRAMING AT CONDUIT BANK
 NOT TO SCALE

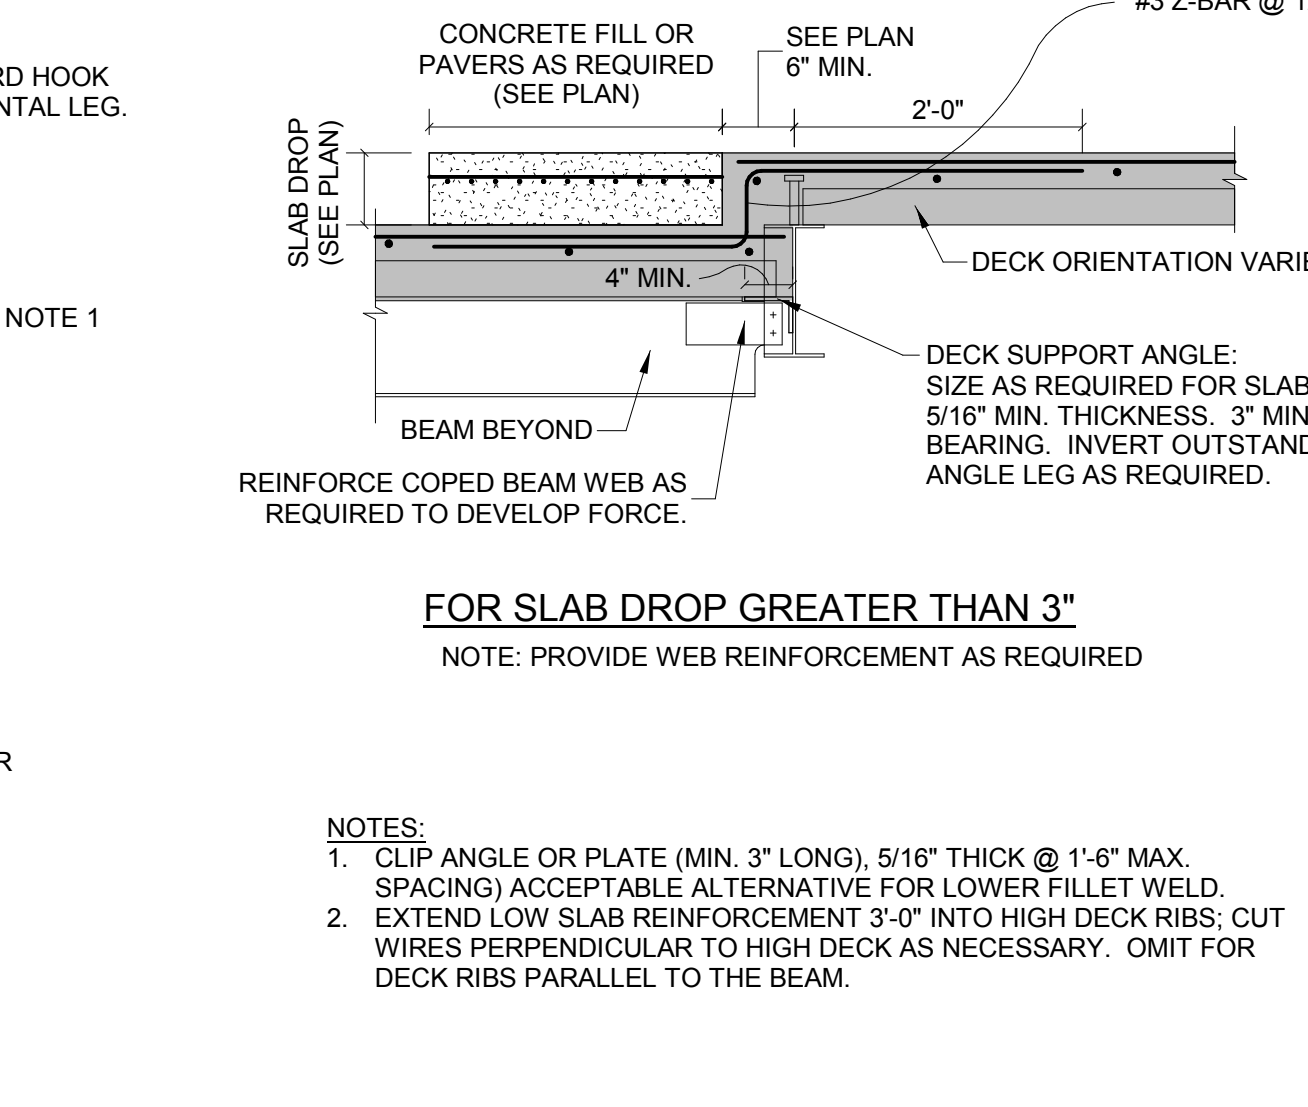

13 TYPICAL STAIR HEADER BEAM DETAIL
 NOT TO SCALE

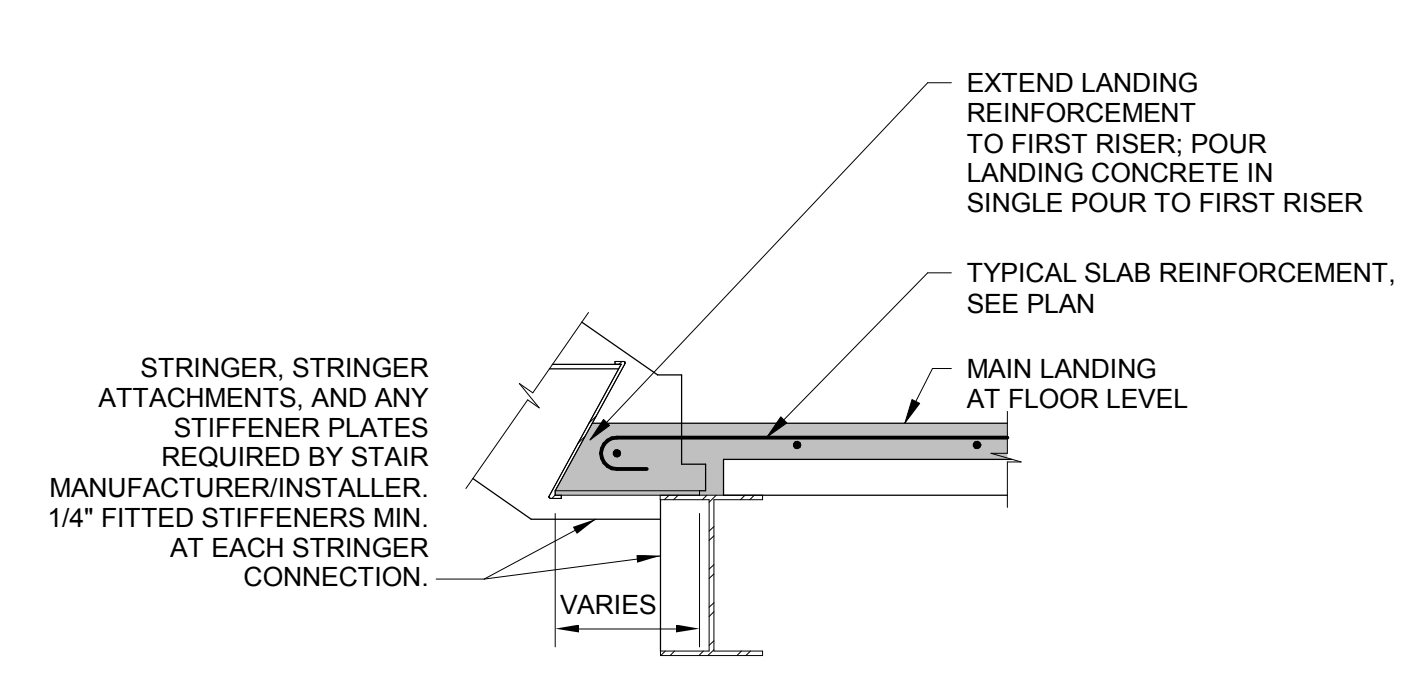

15 CONDUIT PLACEMENT IN COMPOSITE SLABS
 NOT TO SCALE

