


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

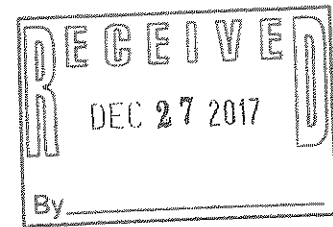

NOTICE OF VIOLATION AND ORDER TO CORRECT

WILLIAM FOX
 PO BOX 3777
 HALLANDALE FL 33008

December 7, 2017

Location 39 SPRUCE ST	CBL 056 D032001	Inspection Date 11/7/2017
Inspector Gene Cote	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 12/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. each unit front and rear stairwell ✓	1/8/2018
NFPA 101- 31.3.1.1.1 VERTICAL OPENINGS NOT FIRE RATED; Vertical openings shall be enclosed or protected in accordance with Section 8.6. In the closet on first floor under stairs and above the basement stairs. ✓	3/1/2018
NFPA 101-31.3.2.1 AND 31.3.2.1.1 PROTECTION OF HAZARDOUS AREAS NOT PROVIDED; Any hazardous area shall be protected in accordance with Section 8.7. The areas described in Table 31.3.2.1.1 shall be protected as indicated. 3 story attached shed has no fire rated separation to the rear stairs. ✓	9/1/2018
NFPA 101- 7.2.8.5.1 HANDRAILS REQUIRED ON STAIRS; All fire escape stairs shall have walls or guards and handrails on both sides in accordance with 7.2.8.4.1 (b). 3rd floor ✓	6/1/2018
NFPA 101-7.10.5.1 NORMAL ILLUMINATION FOR EXITS; Every sign required by 7.10.1.2, 7.10.1.5, or 7.10.8.1, other than where operations or processes require low lighting levels, shall be suitably illuminated by a reliable light source. Externally and internally illuminated signs shall be legible in both the normal and emergency lighting mode. Rear stairwell ✓	6/1/2018
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. Rear stairwell kept clear of all storage	1/8/2018

Violation	Proposed Date of Completion
NFPA 54 UNPROTECTED OUTSIDE GAS LINE; See NFPA 54 regarding requirements for outdoor unprotected gas lines. meters and line have no protection	6/1/2018
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) Basement wall gas unit and 2 gas water heaters in basement	4/1/2018
NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. all units need fire doors	9/1/2018
FINAL DATE OF COMPLETED VIOLATION(S)	___/___/___
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	___/___/___

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

12/21/2017
Date

Thomas Davis
Responsible Party

Date

Responsible Party

SEEN AND AGREED

to 12/27/17
Date

CAPT. JBB
Fire Prevention Bureau