


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

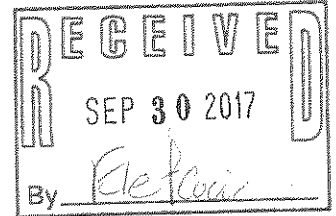

NOTICE OF VIOLATION AND ORDER TO CORRECT

September 15, 2017

Responsible Party 1: Lever Brian 56 Peary Terrace South Portland, ME 04106		
(Bellport)		
Location 258 SPRING ST	CBL 057 C001001	Inspection Date 8/16/2017
Inspector Sean Donaghue	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 9/30/2017.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
PORTLAND FIRE DEPARTMENT CHAPTER 10 4.6.1, 4.6.2 UNIT/SUITE NUMBERS NOT MARKED; 4.6.1 Residential units shall be designated using numerals. 4.6.2 The first numeral of each residential unit shall be the floor designation. All inside unit doors must be marked with corresponding unit numbers	11 / 30 / 17
NFPA 101- 7.2.1.8.1 FIRE DOORS MUST BE SELF- OR AUTO-CLOSING; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise permitted by 7.2.1.8.3. All fire doors must be self closing, noted 1st and 3rd floor rear stairwell doors are not self closing	11 / 30 / 17
NFPA 101- 31.3.4.5.1 SMOKE ALARMS REQUIRED; In buildings other than those equipped through out with an existing, complete automatic smoke detection system, smoke alarms shall be installed in accordance with 9.6.2.10, as modified by 31.3.4.5.2, outside every sleeping area in the immediate vicinity of the bedrooms and on all levels of the dwelling unit, including basements. 2nd floor common area requires combination detector, front bedroom and closet being used as a bedroom require smoke detectors	IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.
NFPA 1 EXCESSIVE/DISORDERLY STORAGE; Reference NFPA 1 for excessive fuel-load. Please remove 3rd floor rear stairwell debris, all egress hallways clear of all debris	11 / 30 / 17
NFPA 70 MISSING BREAKER IN PANEL; Refer to NFPA 70, National Electrical Code, for information on missing breakers in an electrical panel. Open breaker slot on panel in basement marked 2nd, please put in a breaker or a blank	11 / 30 / 17

Violation	Proposed Date of Completion
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated. Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) Wall mounted gas fired boiler in basement rear requires sprinkler protection	11 / 30 / 17
NFPA 101- 8.3.4.2 60 MINUTE FIRE DOOR REQUIRED; Refer to NFPA 101- Table 8.3.4.2 that states fire door assemblies for vertical shafts (including stairways, exits, and refuse chutes) are rated and required for 1 hour. Please provide evidence that all unit doors are 60 minute or greater fire rated doors	11 / 30 / 17
FINAL DATE OF COMPLETED VIOLATION(S)	11 / 30 / 17
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.


VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

9/29/17
Date

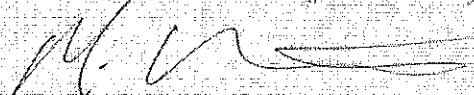
Responsible Party

Date

Responsible Party

SEEN AND AGREED

10/02/2017
Date

CAOT. JPB 
Fire Prevention Bureau