


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

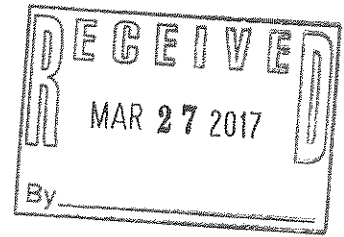

NOTICE OF VIOLATION AND ORDER TO CORRECT

January 4, 2017

Responsible Party 1: Fernald Seth 45 MAPLE AVE SCARBOROUGH, ME 04074		
Location 23 ROBERTS ST	CBL 066A D003001	Inspection Date 12/22/2016
Inspector Christopher Goodall	Inspection Type FP Routine Inspection	Status Failed

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must complete the proposed date of completion column by proposing a reasonable timeframe to remedy each violation. This form must be received by the Fire Prevention Bureau no later than 1/30/2017. The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

YOUR FAILURE TO SUBMIT A PLAN OF ACTION BY THE DATE PROVIDED, OR TO CORRECT ANY VIOLATION WITHIN THE APPLICABLE TIME FRAME, MAY RESULT IN LEGAL ACTION AGAINST YOU, THE IMPOSITION OF CIVIL PENALTIES, AND THE PURSUIT OF OTHER LEGAL REMEDIES.

Violation	Proposed Date of Completion
NPFA 101- 7.2.2.1.1 STAIRS REQUIRE REPAIR; Stairs shall meet the following criteria: (1) New stairs shall be in accordance with Table 7.2.2.2.1.1(a) (2) Existing stairs shall be permitted to remain in use, provided that they meet the requirements for existing stairs shown in Table 7.2.2.2.1.1(b) (3) Approved existing stairs shall be permitted to be rebuilt in accordance with the following: (a) dimensional criteria of table 7.2.2.2.1.1(b) and other stair requirements of 7.2.2 (4) The requirements for new and existing stairs shall not apply to stairs located in industrial equipment access areas where otherwise provided in 40.2.5.2. Broken treads in front stairwell	3/27/17
NFPA 58- 8.3.1(A) STORAGE OF PROPANE EXCEEDS LIMITS; See NFPA 58, Table 8.3.1(a) Maximum Allowable Storage Quantities of LP-Gas in Other Than Industrial, Storage, and Mercantile Occupancies. Propane gas cylinder stored in basement	IMMEDIATELY remove all excess flammable/combustible material from the interior of the structure. Your signature below indicates that all excess material has been removed, will not be replaced, and will be properly disposed of or stored elsewhere.
NFPA 101- 31.3.2.1.1 BOILER PROTECTION REQUIRED; The areas described in Table 31.3.2.1.1 shall be protected as indicated: Boiler and fuel-fired heater rooms serving more than a single dwelling unit (minimum separation/protection is 1 hour or sprinklers) No sprinkler head over gas heater	3/27/17

Violation	Proposed Date of Completion
NFPA 1, CHAPTER 10 - 10.11.6 HIBACHI OR GRILL ON BALCONY; NO HIBACHI, GAS-FIRED GRILL, CHARCOAL GRILL, OR OTHER SIMILAR DEVICES USED FOR COOKING, HEATING, OR OTHER PURPOSE, SHALL BE USED OR KINDLED ON ANY BALCONY OR UNDER ANY OVERHANG PORTION OR WITHIN 10 FT OF ANY STRUCTURE Charcoal grill on second floor porch	<u>3/27/13</u>


VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

3/23/17
Date


Responsible Party

Date

Responsible Party

SEEN AND AGREED

3/27/17
Date

CAPT. JRB 
Fire Prevention Bureau