



# SUBSURFACE WASTEWATER DISPOSAL SYSTEM APPLICATION

Maine Dept. of Health & Human Services  
 Division of Environmental Health, STS 11  
 (207) 287-5338 FAX (207) 287-3165

Town, City, Plantation  
**PORTLAND, PEAKS/SCAND**

Street, Road, Subdivision  
**73 SARGENT ROAD**

Owner or Applicant Name  
**THOMAS WHITNEY**

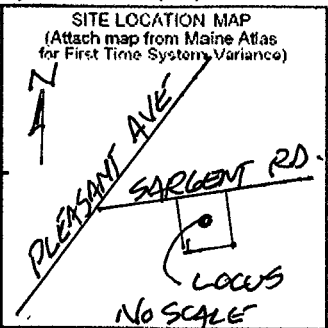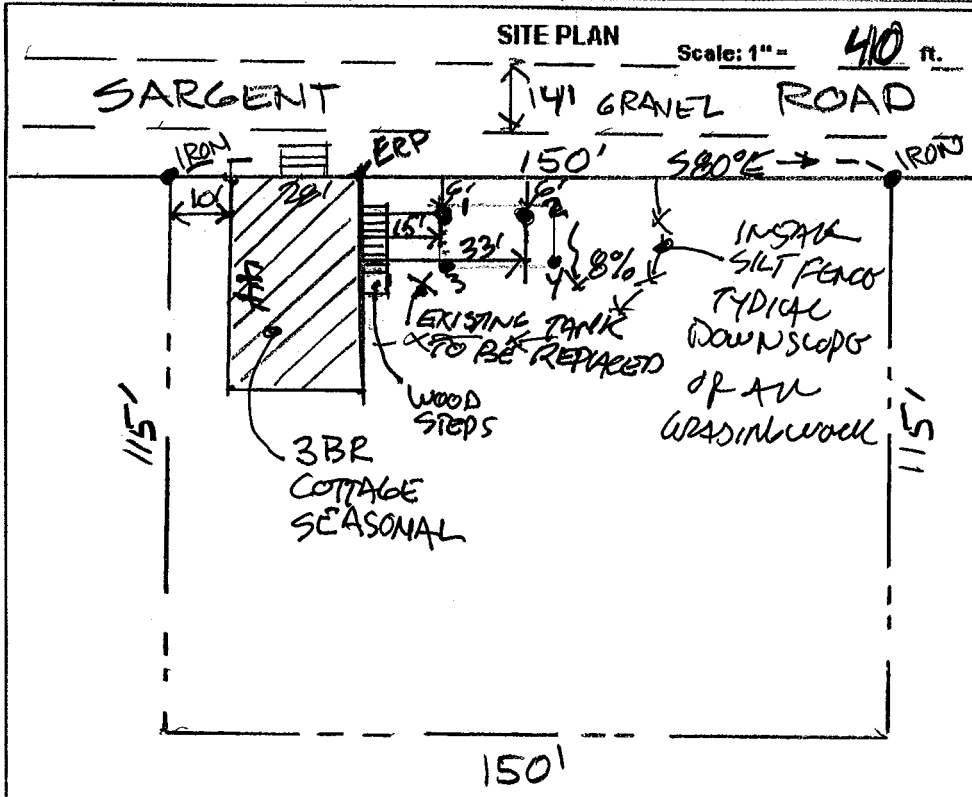

\*SOIL APPEARS TO BE OLD FILL (COTTAGE BUILT AROUND 1915<sup>L</sup>)

## SOIL PROFILE DESCRIPTION AND CLASSIFICATION

(Location of Observation Holes Shown Above)

Observation Hole # 1  Test Pit  Boring

0 " Depth of organic horizon above mineral soil

Texture	Consistency	Color	Mottling
SANDY LOAM		DARK BROWN	
	FRIABLE		
GRAVEL	LOOSE	DARK REDDISH BROWN	
			FREE H <sub>2</sub> O

Soil Profile	Classification Condition	Slope Percent	Limiting Factor Depth	<input checked="" type="checkbox"/> Groundwater <input type="checkbox"/> Restrictive Layer <input type="checkbox"/> Bedrock
G	C	B	24	

Observation Hole # 2  Test Pit  Boring

0 " Depth of organic horizon above mineral soil

Texture	Consistency	Color	Mottling
LOAM	FRIABLE	DARK BROWN	
SILT LOAM	SLIGHTLY FIRM	OLIVE GRAY	
			FREE H <sub>2</sub> O
	VERY FIRM		
	FIRM		

Soil Profile	Classification Condition	Slope Percent	Limiting Factor Depth	<input checked="" type="checkbox"/> Groundwater <input type="checkbox"/> Restrictive Layer <input type="checkbox"/> Bedrock
G	C	B	24	

**David A. Kel**  
 Site Evaluator Signature

**185**  
 SE #

**6/20/13**  
 Date