


CITY OF PORTLAND
 FIRE PREVENTION BUREAU
 380 Congress Street, Portland, Maine 04101
 fireprevention@portlandmaine.gov
 (207) 874-8400

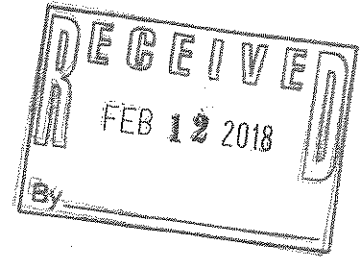

NOTICE OF VIOLATION AND ORDER TO CORRECT

February 2, 2018

Blue Atlantic Portland LLC
 500 N DEERBORN STE 400
 CHICAGO IL 60654

BAYSIDE VILLAGE
 132 MARGINAL WAY
 PORTLAND ME 04101

Location 132 MARGINAL WAY	CBL 442 A001001	Inspection Date 12/6/2017
Inspector Curtis Magnuson	Inspection Type FP Routine Inspection	Status Failed —

The City of Portland Fire Department inspected this property, and found the fire and life safety code violations listed below, which you are hereby ordered to correct. You must propose a date of completion to remedy each violation, a final date of completion, and a date of re-inspection.

You must send this form to the Fire Prevention Bureau no later than 2/28/2018.

Your failure to submit a plan of action by the date provided, or to correct any violation within the applicable time frame, may result in legal action against you, the imposition of civil penalties, and the pursuit of other legal remedies.

Violation	Proposed Date of Completion
<p>NFPA 101- 7.9.1.1 EMERGENCY LIGHTING REQUIRED; Emergency lighting facilities for means of egress shall be provided in accordance with Section 7.9 for the following: (1) Buildings or structures where required in Chapters 11 through 43 (2) Underground and limited access structures as addressed in Section 11.7 (3) High-rise buildings as required by other sections of this code (4) Doors equipped with delayed-egress locks (5) Stair shaft and vestibule of smokeproof enclosures, for which of the following also apply: (a) The stair shaft and vestibule shall be permitted to include a standby generator that is installed for the smokeproof enclosure mechanical ventilation equipment (b) The standby generator shall be permitted to be used for the stair shaft and vestibule emergency lighting power supply (6) New access-controlled egress doors in accordance with 7.2.1.6.2 All of the emergency lights that were tested failed to operate.</p>	<p>2/28/18 4th - 2nd Floor completed</p>
<p>NFPA 720- 5.5.6.1 CO ALARMS REQUIRED; The performance, location, and mounting of notification appliances used to initiate or direct action, evacuation or relocation of the occupants, or for providing information to occupants or staff, shall comply with the requirements of Chapter 6. The fire department requires one, hardwired with battery back up, CO detector in the common area of each unit.</p>	<p>IMMEDIATELY install temporary alarms where required. Your signature below indicates that temporary alarms have already been installed.</p>
<p>NFPA 101- 7.2.1.8.1 DOORS SHALL BE SELF-CLOSING & SELF-LATCHING; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise specified by 7.2.1.8.3. The stairwell door on the 1st floor will not close on its own. This door is located near the elevator.</p>	<p>Completed</p>

We are in the process of ordering 100 CO Alarms from HD supply to install in every common area. The cost of this is \$60K - We believe in would be counter productive to order temporary one's, install them to then un-install to put the permanent fix. This project will be completed by 3/2/18.

Violation	Proposed Date of Completion
NFPA 101- 7.2.1.8.1 DOORS SHALL BE SELF-CLOSING & SELF-LATCHING; A door leaf normally required to be kept closed shall not be secured in the open position at any time and shall be self-closing or automatic-closing in accordance with 7.2.1.8.2, unless otherwise specified by 7.2.1.8.3. Some of the center hallway fire doors do not close when the panic bar is activated. Also the doors, when they are in the closed position, do not latch.	Completed
NFPA 1- 1.12.5.13 FIRE ALARM INSPECTION STICKER REQUIRED; Permits shall be issued by the AHJ and shall bear the name and signature of the AHJ or that of the AHJ's designated representative. In addition, the permit shall indicate the following: (1) Operation or activities for which the permit is issued (2) Address or location where the operation or activity is to be conducted (3) Name and address of the permittee (4) Permit number and date of issuance (5) Period of validity of the permit (6) Inspection requirements and other permit conditions	2/28/18
FINAL DATE OF COMPLETED VIOLATION(S)	3/2/18
FIRE PREVENTION BUREAU RE-INSPECTION OF COMPLETED VIOLATION(S)	3/7/18

The Bureau reserves the right to reject or modify any proposed plan of action, and may require evidence of sufficient financial and technical capacity to complete the proposed plan. Please contact the Bureau with any questions.

VIOLATOR CERTIFICATION

I agree to remedy the violations listed within the timeframes provided. If I require additional time to comply, I understand that I must contact the Fire Prevention Bureau prior to the deadline to request an extension, which is entirely within the Bureau's discretion to grant or deny.

I further understand that it is my responsibility to schedule a reinspection of my property once the violations have been remedied to do so. My failure to schedule a reinspection shall be deemed an admission that the violations have not been remedied.

If I fail to comply with this agreement, I understand that I am liable for penalties pursuant to the City of Portland Code of Ordinances §§ 1-15 and 10-25, and 30-A M.R.S. § 4452 and may be subject to further legal action.

2/6/18
Date

Chase Schudt
Responsible Party

Date

Responsible Party

SEEN AND AGREED

2/12/18
Date

CAPT. JRB
Fire Prevention Bureau